



Plate 110. Albert B. Culver, Jr. House (3-34-13.20-82), From the South.

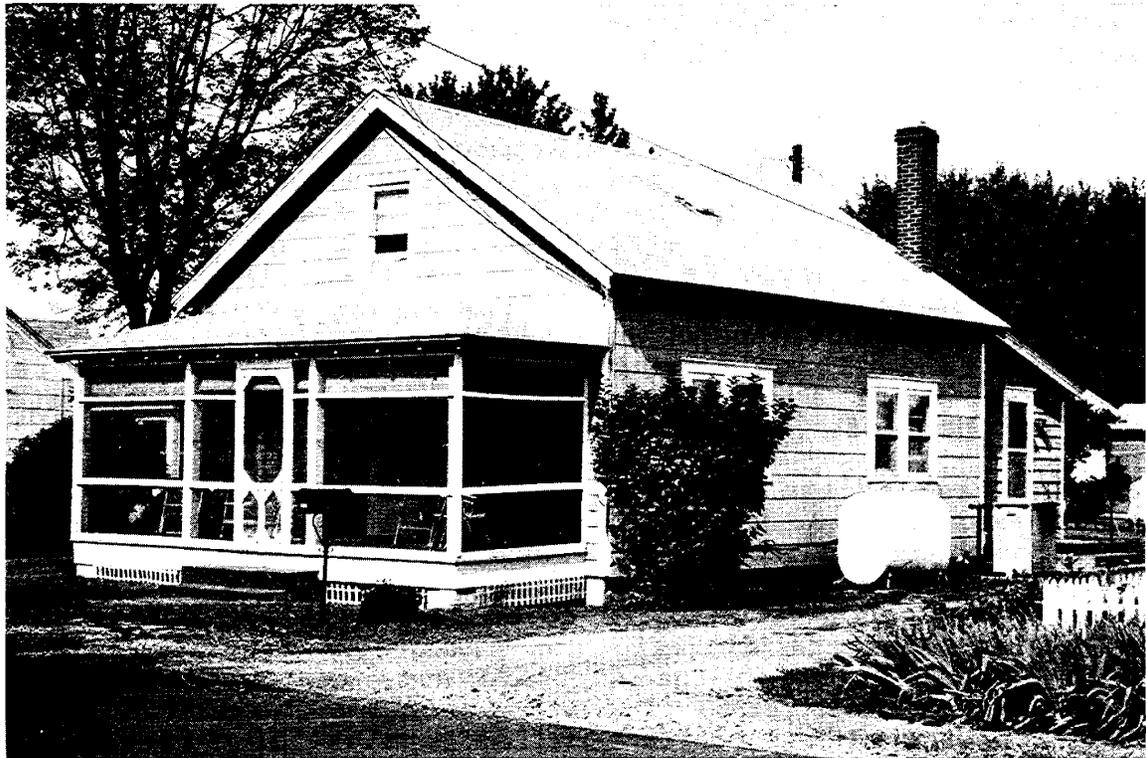


Plate 111. Sarah J. Burton House (3-34-13.20-83), From the East.

roof with composite shingles. The southeastern elevation, a gable end, faces Atlantic Street and forms the three bay facade. Across the facade is a one story wood framed enclosed porch with a hipped roof covered with composite shingles. A centered hollow core entrance door leading into the porch is set between 3/1 sash windows in plain surrounds with a simple molding on top of the lintel. Similar windows are set into the southwest elevation, one 3/1 sash window on the enclosed porch, a paired window and another single 3/1 sash window in the main block. On the northeast elevation are three single 3/1 sash windows and one paired 3/1 window as well as a second entrance door near the northern end. Across the northwestern elevation is a one story extension of the main block, with a gable roof set lower than the main block roof. A brick chimney is centered on the ridge of the main block.

Sarah J. Burton House and Cottage c. 1920s
110 Atlantic Street (tax map #3-34-13.20-83)
Figure 42; Plates 111 and 112
CRS #S-8039

Description: The Sarah J. Burton House is a one and a half story wood framed gable roofed dwelling with the gable ended southeastern elevation facing Atlantic Street as the facade. A one story hip roofed screened porch encloses the three bays of the facade. The facade contains an axial sash entrance door flanked by 1/1 sash windows. Centered in the gable above the screened porch is a 1/1 sash window. The side elevations have different fenestration: on the southwest elevation, four single 1/1 sash windows; on the northeast, two paired 1/1 sash windows. All windows and door openings are trimmed with plain surrounds and a molded strip atop the lintel which forms a small hood-mold. The overhang of the roof has exposed rafter ends at the eaves and molded trim on the gable ends and is covered with composite shingles. A similar treatment has been given to the exterior walls above the concrete block foundation. A one story shed roofed addition extends from the northwestern or rear elevation, where a brick chimney rises from the northeastern slope of the roof.

Standing east of the main dwelling is the one and a half story wood framed Sarah J. Burton Cottage with a one story shed roofed addition on the southeastern elevation and a small one story gable roofed addition on the western half of the southwestern elevation. Composite shingles cover the walls and gabled roof. On the northeastern elevation or facade an exterior concrete block chimney occupies the northern end, and a sash entrance door the southern end. Fenestration on the southeastern elevation of the shed roofed addition consists of three louvered windows.



Plate 112. Sarah J. Burton Cottage (3-34-13.20-83), From the Southeast.



Plate 113. Richard D. Aiken House (3-34-13.20-84), From the East.

A garage stands to the north of the main dwelling, at the end of a driveway which parallels the northeastern elevation. The exterior walls of the wood framed garage are covered with vertical flush boards. Its shed roof is covered with corrugated metal. An overhead garage door is centered on the southeastern elevation.

Richard D. Aiken House and Cottage c. 1920s
112 Atlantic Street (tax map #3-34-13.20-84)
Figure 42; Plates 113 and 114
CRS #S-8040

Description: The Richard D. Aiken House is a one story wood framed dwelling set on a concrete foundation and clad with composite shingles on the exterior walls and the roof. Originally an ell-plan gable roofed block, the house now includes additions which create a rectangular plan. These additions are a one story shed roofed addition at the northwestern end of the main block and ell, and a one story flat roofed sunporch extending to the northeast of the shed roofed addition. The two bay southeastern elevation, which faces Atlantic Street and forms the facade, includes a sash entrance door in the gable end of the main block and a 1/1 sash window in the ell to the east. Both the entrance door and the windows in the original ell-plan block have plain surrounds with a molding surmounting the lintel. Sheltering the entrance door is a flat porch roof supported by two wood posts on a small concrete porch and step. Fenestration on the southwest elevation consists of two paired 1/1 sash windows symmetrically placed in the main block and a smaller louvered window in the shed roofed addition. One 1/1 sash window is centered in the northeast gable end of the ell. A brick chimney rises from the ridge of the main block roof, to the northwest of the point where the ridge of the ell roof is connected. The one story rectangular wood framed garage is located northwest of the dwelling at the end of a driveway which parallels the northeast elevation of the house. Its gable end faces the street. Composite shingles clad the exterior walls and the gable roof. An overhead sliding door with six lights is set in a plain surround with a molding surmounting the lintel.

The one story rectangular wood framed Richard D. Aiken Cottage is located northwest of the house in the backyard. Both the exterior walls and the gable roof are clad in composite shingles. The southeast elevation faces the street and forms the facade composed of a central sash door flanked by 2/2 sash windows. On the northeastern gable end are two 2/2 casement windows. No chimney is evident.



Plate 114. Richard D. Aiken Cottage (3-34-13.20-84), From the Southeast.



Plate 115. Harry F. Lekites House (3-34-13.20-85), From the Southeast.

Harry F. Lekites House c. 1940s
Atlantic Avenue (tax map #3-34-13.20-85)
Figure 42; Plate 115
CRS #S-8041

Description: The Harry F. Lekites House is a one story gable roofed concrete block cottage sited at the rear of the lot, with a southeastern elevation facing Atlantic Avenue and forming a three bay facade. The sash entrance door stands between a double leafed casement window and a tripartite window in which the central fixed light has been replaced with concrete block infill. Composite shingles cover the roof. A double leafed casement window is centered in each of the gable end elevations. All windows have projecting wooden sills.

Harry F. Lekites House, Cottage, and Garage c. 1920s
118-120 Atlantic Street (tax map #3-34-13.20-86)
Figure 42; Plates 116-118
CRS #S-8042

Description: The stuccoed house rests on a concrete block foundation close to the intersection of Washington and Atlantic Streets with a southeastern elevation facing Atlantic Street and forming a five bay facade. The one and a half story gable roofed main block has a brick exterior chimney centered on the facade, to which a one story shed roofed enclosed porch and a one story gable roofed section have been added. A sash entrance door is flanked by three porch windows on the southern side and one 1/1 sash window in the gable roofed section to the east. In the peak of the gable roofed addition on the facade a four light casement window is centered. On the southwestern elevation are located: 1) a cross-gabled one and a half story projecting bay with a paired 1/1 window on the first story and a four light casement window in the gable peak; 2) a one story semi-hexagonal bay window with three 1/1 sash windows; 3) a paired 1/1 sash window in the westernmost bay of the first story; and 4) two hip roofed dormers, one above the bay window and one above the paired 1/1 windows, each dormer containing a paired 6/1 window. On the northeastern elevation four windows of various sizes, two sash doors and two nine light windows are located. All window and door openings are trimmed with wide plain surrounds. Composite shingles cover all the roof surfaces.

The gable roofed cottage is located northeast of the main dwelling, with a southwestern elevation facing Washington Street and forming a two bay facade. The one story wood framed cottage appears to have been an ell plan main block, with a porch enframed by the ell now enclosed. The walls above the concrete foundation are covered with composite German siding, with fishscale shingling filling the peak of the gable above the window lintels on the southeastern elevation. Composite shingles cover the roof. On the northwestern elevation is an



Plate 116. Harry F. Lekites House (3-34-13.20-86), From the South.



Plate 117. Harry F. Lekites Cottage (3-34-13.20-86), From the South.

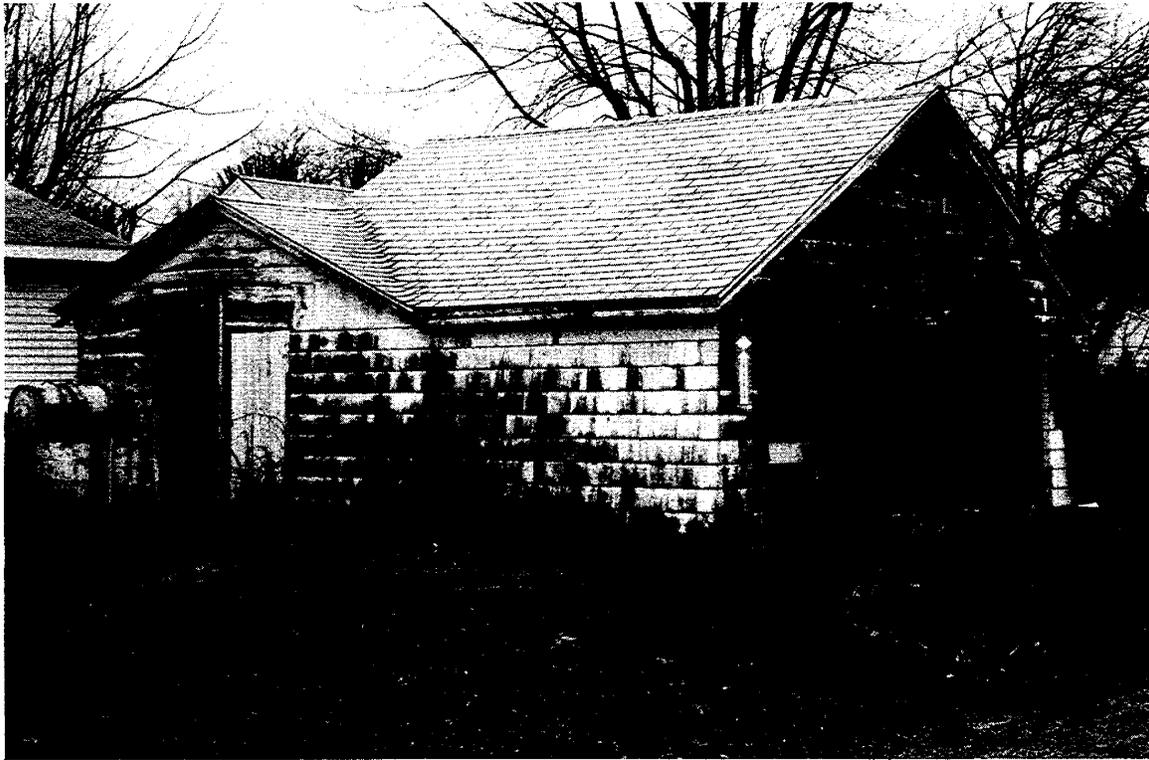


Plate 118. Harry F. Lekites Garage (3-34-13.20-86), From the South.



Plate 119. Bernice S. Ahern House (3-34-13.20-87), From the Southwest.

axial brick exterior chimney. The sash entrance door is centered in the southwestern gable end of the main block; one 1/1 sash window is located on the facade of the enclosed porch. Two 1/1 sash windows appear on the southeastern elevation, enframed by plain surrounds. Other window and door openings are similar to these.

The garage is a one and a half story gable roofed rectangular block, located northwest of the house and northeast of the cottage at the bend of the driveway. Above the concrete block foundation the walls are covered with wood shingles, and the roof with composite shingles. An opening in the southeastern gable end elevation allows access for two cars. Centered in the gable above is a small access door to the loft space. Below a one story cross gabled roof extension at the western end of the southwestern elevation are two entrance doors of unequal height.

The one story rectangular wood framed shed is located to the north of the house, with plywood covering the exterior walls and corrugated metal covering the gabled roof. The opening for an entrance door is near the western end of the southwestern elevation.

Bernice S. Ahern House and Cottage c. 1960s, c. 1940s
122 Washington Street (tax map #3-34-13.20-87)
Figure 42; Plates 119 and 120
CRS #S-8043

Description: The Bernice S. Ahern House and Cottage share ownership and parking space with three buildings on the property to the west, tax map #3-34-13.20-88. The house is sited close to Washington Street. The cottage stands directly behind and to the northeast of the house.

The house, probably dating from the 1950s, is a rectangular one story gable roofed wood framed dwelling, with porches included under the slope of the roof at the western and northern corners. Above the concrete block foundation the walls are clad in metal siding, and the roof is covered with composite shingles. The southwest elevation faces Washington Street and forms a two bay facade, with a sliding glass entrance door from the porch and a paired 1/1 sash window in the southern half of the elevation. Four paired louvered windows light the northwestern elevation. All windows are trimmed with louvered shutters. This house is consistent in form, materials, scale, and function with older houses in the district, and thus is a contributing resource.

The cottage is a one story rectangular wood framed dwelling, the northwestern slope of the gable roof raised and extended to shelter a screened porch which encloses the three bays of the northwestern elevation or facade. An axial sash entrance door in plain surrounds is flanked by 1/1 sash windows on the facade.

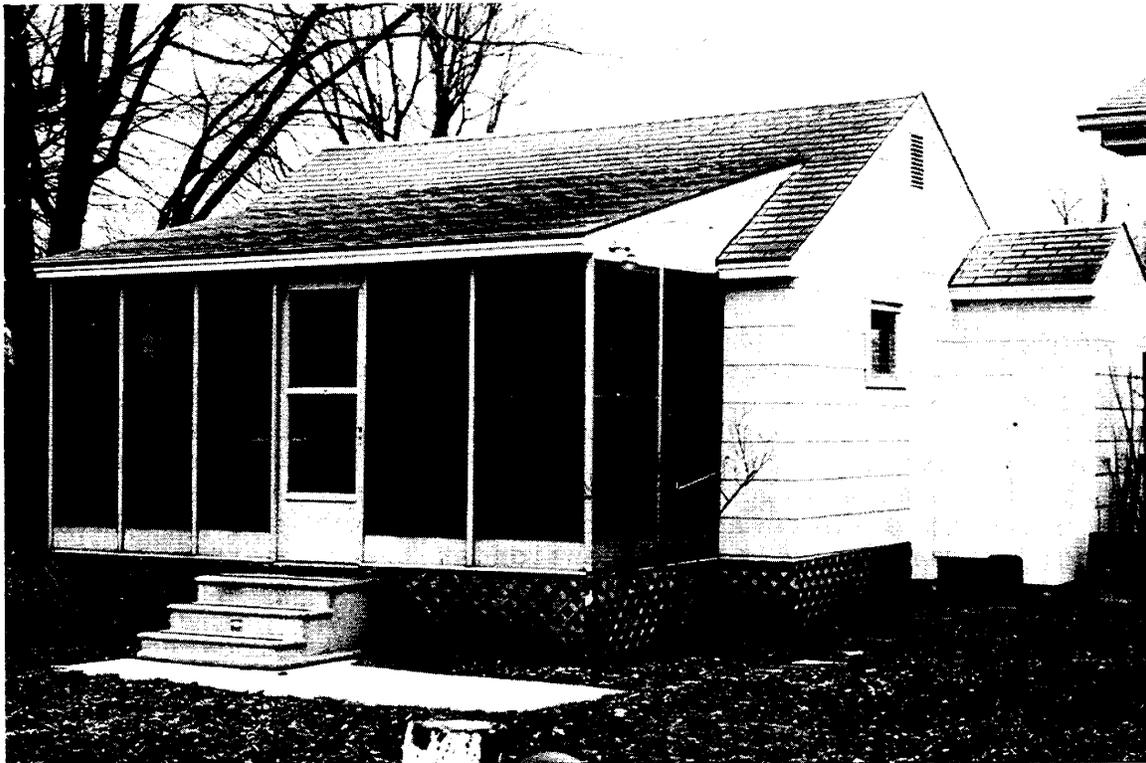


Plate 120. Bernice S. Ahern Cottage (3-34-13.20-87), From the West.

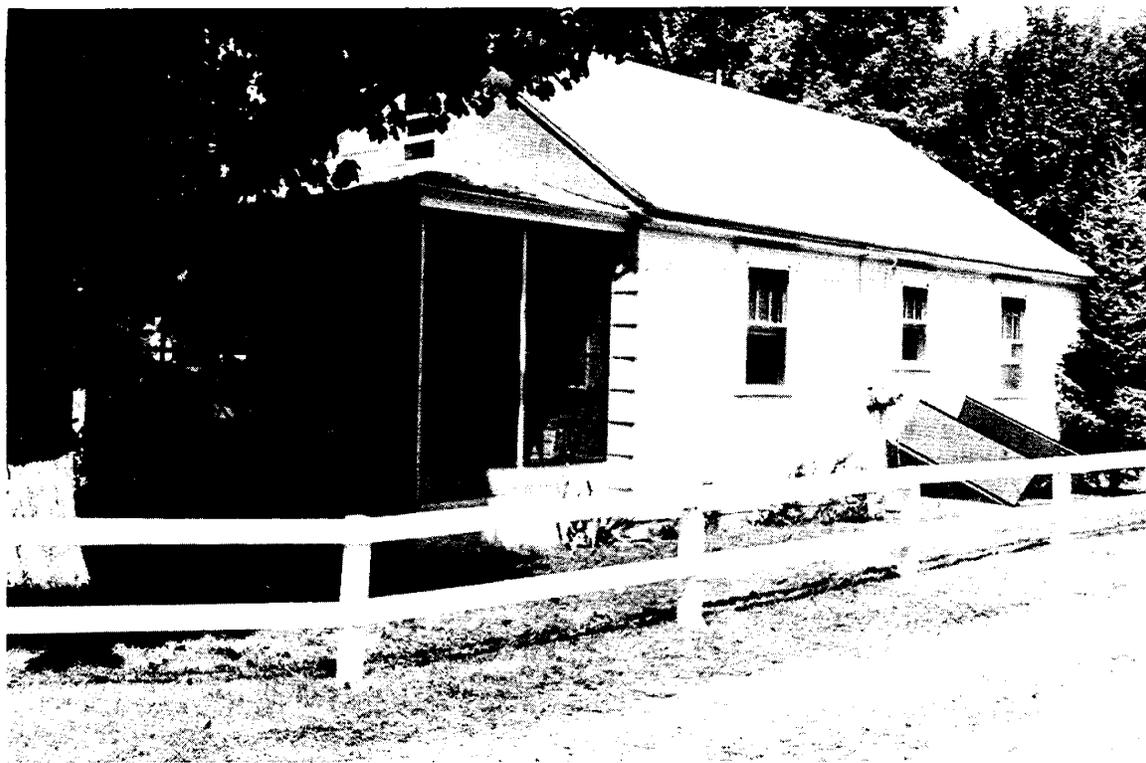


Plate 121. Bernice S. Ahern House (3-34-13.20-88), From the South.

Latticework screens the concrete piers of the foundation, and composite shingles cover the exterior walls and the roof. A small gable roofed addition occupies the southernmost end of the southwestern elevation.

Bernice S. Ahern House and Cottage c. 1920s, c. 1940s
124 Atlantic Street (tax map #3-34-13.20-88)
Figure 42; Plates 121 and 122
CRS #S-8044

Description: This Bernice S. Ahern House and Cottage share ownership and parking space with two buildings on the property to the east, tax map #3-34-13.20-87. The house is sited close to Washington Street. The cottage stands northeast of the house and a shed stands directly behind the house.

The house is a rectangular one and a half story wood framed dwelling with a one story hip roofed screened porch enclosing the three bays of the facade or southwestern gable and elevation. An axial sash entrance door in molded surrounds stands between windows within the porch. Above the concrete foundation the exterior walls and roof slopes are covered with composite shingles. All window openings are trimmed with plain surrounds, a molded strip atop the lintels forming hood molds. Three/one sash windows are positioned in the peak of the gable, flanking the entrance, in three bays on the southeast elevation, and as two paired and two single windows on the northwestern elevation. A brick exterior chimney is centered on the northwestern elevation. This cottage is identical to the one located at 122 Atlantic Street.

The outbuilding which stands behind the house is a one story rectangular wood framed shed. Above the concrete slab on which it rests the exterior walls are covered with metal sheathing, and the gambrel roof is covered with composite shingles. A vertically sliding metal door is located on the southwestern elevation.

Mildred M. Phillips House c. 1920s
632 Rehoboth Avenue (tax map #3-34-13.20-92)
Figure 42; Plate 123
CRS #S-8045

Description: The Mildred M. Phillips House is a one and a half story wood framed rectangular block, set on a foundation of rock-faced CMU with the northern elevation facing Rehoboth Avenue. The exterior walls are clad in metal siding. On the composite shingled roof a corbeled brick chimney is centered on the ridge. The pitch of the overhanging gabled roof is raised at the level of the second story window lintels and includes, under the northern or front slope, a wood framed screened porch with wood posts and a wood railing upheld by square section

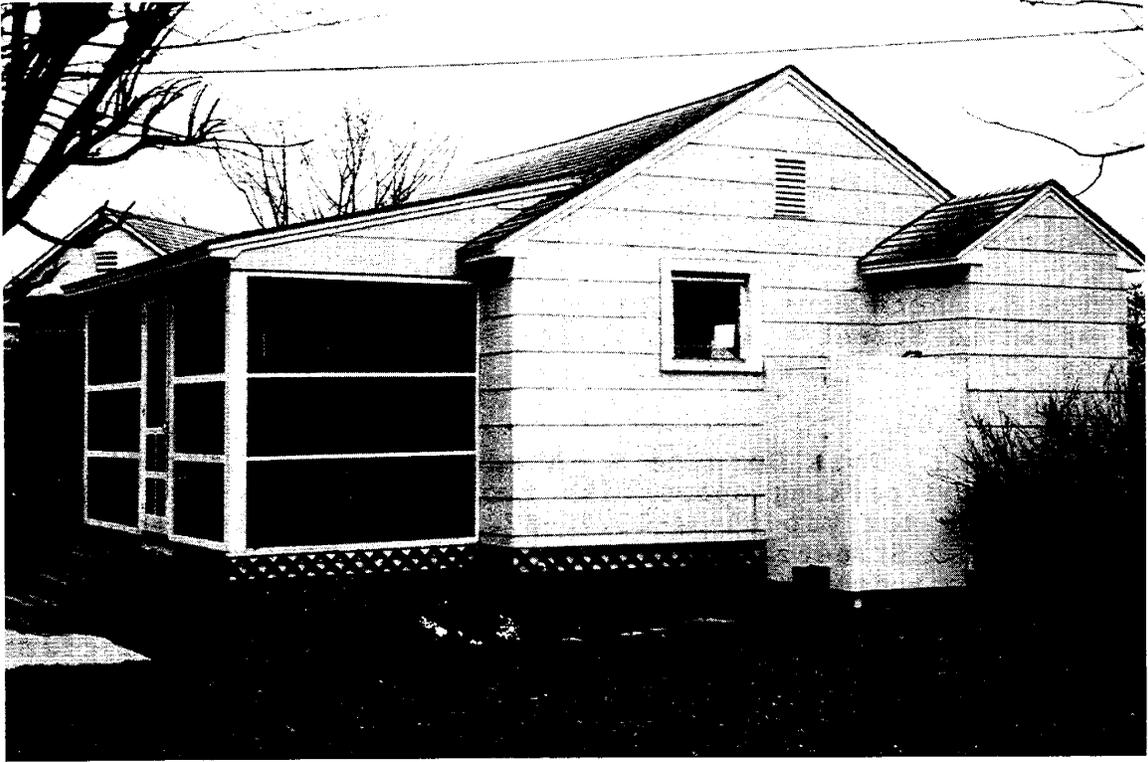


Plate 122. Bernice S. Ahern Cottage (3-34-13.20-88), From the Southwest.

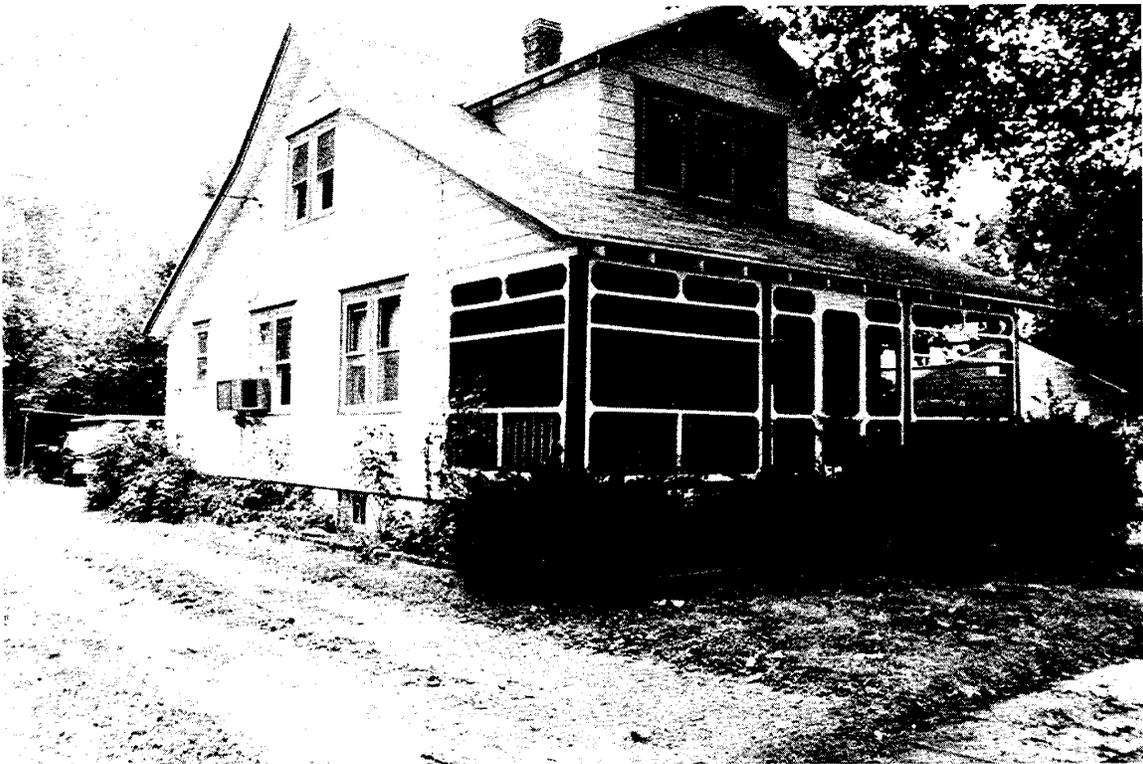


Plate 123. Mildred M. Phillips House (3-34-13.20-92), From the Northeast.

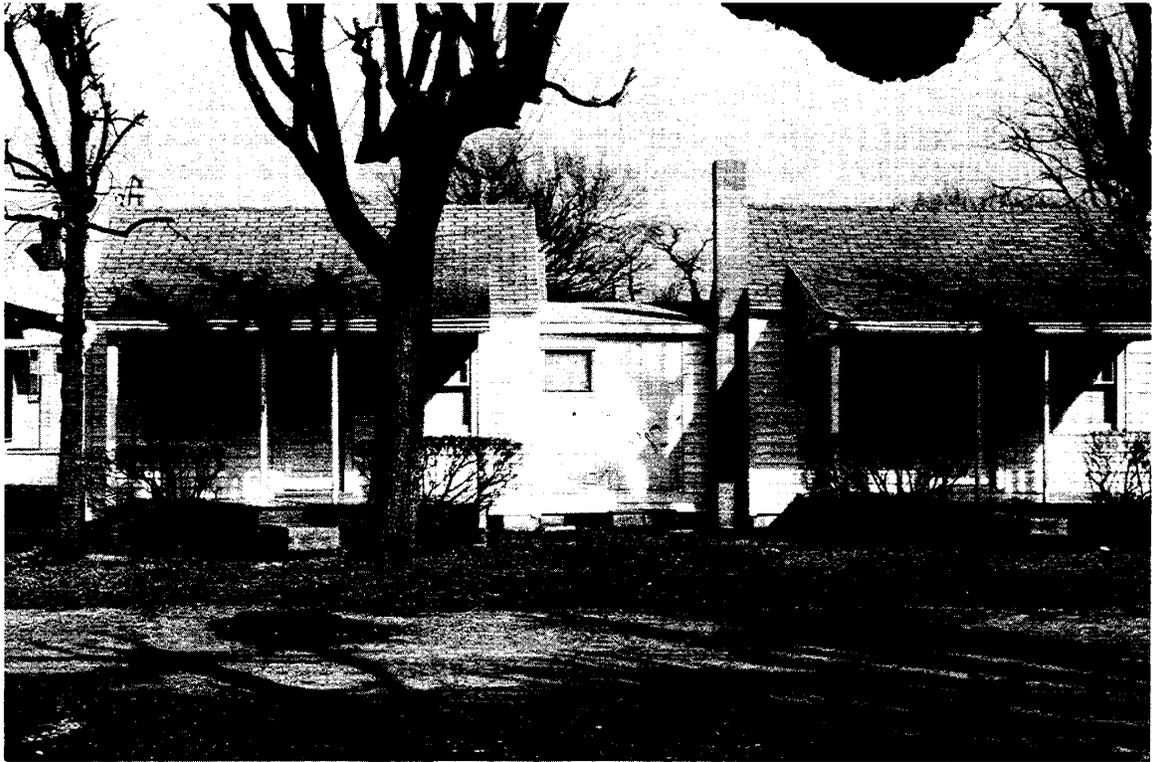


Plate 124. Phil-Moore Cottages 1 and 2 (3-34-13.20-93), From the West.



Plate 125. Phil-Moore Cottage 5 (3-34-13.20-93), From the West.

balusters. Within the porch the sash entrance door is centered between paired 1/1 sash windows. An axial gable roofed dormer on the front roof slope lights the second story through a tripled 1/1 sash window. Fenestration on the eastern elevation includes a paired 1/1 sash window centered on the second story and two paired and one single 1/1 sash windows on the first story. On the western elevation a paired 1/1 sash window is centered on the second story and an axial paired 1/1 sash window is flanked by single 1/1 sash windows on the first story. All the window and door openings are trimmed with plain surrounds, a molded strip atop the lintels forming a small hood mold. One outbuilding stands on this property, a shed located to the south of the dwelling. The shed is a one story wood framed rectangular block resting on concrete block piers. Its exterior walls are covered with vertical flush boards. The gabled roof is covered with composite shingles. A one story shed roofed addition to the eastern elevation is covered with vertical flush boards on the exterior walls and corrugated metal on the roof. Entrance doors on the northern elevation are of vertical flush boarding on the main block and a sash door in the addition.

Phil-Moore Cottages c. 1930
630 Rehoboth Avenue (tax map #3-34-13.20-93)
Figure 42; Plates 124-126
CRS #S-8046

Description: On this property stand six cottages, arranged in a row on the western side of a driveway that runs southward from Rehoboth Avenue. Two pairs of identical cottages, each pair connected by a hyphen, stand closest to Rehoboth Avenue. Two single cottages continue the row to the south, one identical to the paired cottages and one different.

Cottage 1 is a one story wood framed rectangular block set in concrete block piers, the exterior walls covered with composite siding and the roof slopes covered with composite shingles. From the western slope of the gable roof extends a shed roof supported on four slender wood posts, sheltering a porch projecting from the three bay facade. The axial sash entrance door is flanked by 6/1 sash windows on the western elevation; a louvered window is centered in the northern elevation. Connecting Cottage 1 to Cottage 2 is a one story shed roofed enclosed passage, set on concrete block piers, with a vertical flush board entrance door centered in the western elevation. Cottage 2 is identical to Cottage 1, with a louvered window centered in the southern elevation. Cottage 3 is identical to Cottage 1. Cottage 4 is identical to Cottage 1, with the addition of a concrete block exterior chimney west of the center of the northern elevation. The connecting passageway between Cottages 3 and 4 is lighted by a louvered window to the north of the door in the western elevation. Cottage 5 is identical with Cottage 1 except for 6/6 sash windows flanking the entrance door

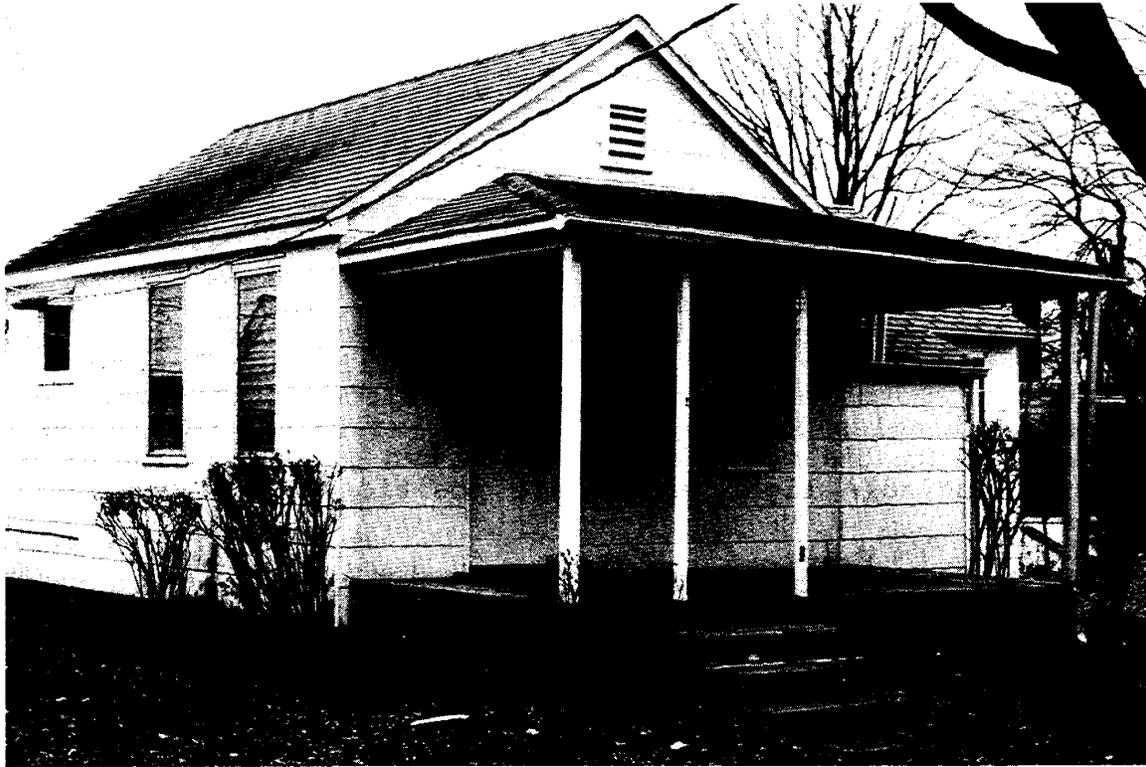


Plate 126. Phil-Moore Cottage 6 (3-34-13.20-93), From the Northwest.



Plate 127. Pauline B. Porter House (3-34-13.20-95), From the Northwest.