

located toward the western end of the northwestern elevation. Further toward the western end of this elevation are located a pair of louvered windows mounted vertically. All the sash windows are in plain surrounds; the louvered windows have no detailing. Across the rear or southwestern elevation of the dwelling is a one story flat roofed wood framed porch, partially covered with clapboarding on the western side.

Robert C. Wothar, Jr. House c. 1920s
119 Atlantic Street (tax map #3-34-13.20-71)
Figure 42, Plate 93
CRS #S-8028

Description: The Robert C. Wothar House is a rectangular one and a half story wood framed dwelling with a wood shingled gabled roof and a concrete foundation. Unstained wood shingles cover the exterior walls beneath the overhanging eaves and exposed rafter ends of the roof. The northwestern gable end faces Atlantic Street and forms the facade. Across the western two-thirds of this three bay facade extends a wood framed one story screened porch with a shed roof. The facade is organized with an axial sash entrance door between a pair of 1/1 aluminum sash windows to the north and a single window of the same detail to the west. On the northeastern elevation are three single 2/2 windows, while on the southwestern elevation are one single window, one pair and one single light fixed window at the southernmost end. All fenestration is contained within plain surrounds. No chimney is evident.

One outbuilding is standing on this property, a rectangular one story wood framed shed with a gabled roof. It is located to the east of the dwelling, gable end to the street. The exterior walls are covered with vertical boards, the roof sheathed in composite shingles. The entrance, located near the southern end of the southwest elevation, was missing the door at the time of this survey. On the same elevation is located a large single light fixed window in plain surrounds.

Philip A. Pacheco House c. 1920s
117 Atlantic Street (tax map #3-34-13.20-72)
Figure 42; Plate 94
CRS #S-8029

Description: The Philip A. Pacheco House is a rectangular one and a half story wood framed dwelling, three bays wide and four bays deep. Set on a foundation of rock-faced CMU, the exterior walls are covered with vertical board cladding beneath the boxed-in overhanging eaves of a composite shingled gabled roof. The gable end facade is the northwestern elevation, across which extends a one story hip roofed enclosed porch with two louvered windows on each side of the axial entrance door. The porch foundation is composed of rock-faced CMU piers and wood lattice,



Plate 94. Philip A. Pacheco House (3-34-13.20-72), From the Northwest.



Plate 95. Walter H. Slockett House (3-34-13.20-73), From the West.

indicating that the porch was part of the original building. Above the facade porch a paired window is centered in the peak of the gable. On the northeast elevation are four 4/1 sash windows. On the southwest elevation are two paired 4/1 sash windows at the western end and two smaller single windows at the southern end. A brick chimney rises from the southwestern slope of the roof near the southern end, close to the one story flat roofed addition which extends from the southeastern gable end of the dwelling. One outbuilding stands on this property, a rectangular one story concrete block shed with a shed roof clad in composite shingles. It is located to the southeast of the dwelling at the end of a driveway which parallels the southwest elevation of the house. The entrance door is positioned at the northern end of the northwestern side which faces the street.

Walter H. Slockett House c. 1920s
115 Atlantic Street (tax map #3-34-13.20-73)
Figure 42; Plate 95
CRS #S-8030

Description: The Walter H. Slockett House is a one and a half story rectangular wood framed dwelling on a concrete foundation, covered on exterior walls and gabled roof with composite shingles. The overhanging edges of the roof are supported on exposed rafter ends above the side elevations. The northwestern elevation, a gable end, faces Atlantic Street and forms the three bay facade. Across the first story of the facade is a one story wood framed screened porch with a hipped roof supported on wood posts. The porch features an overhang and exposed rafter ends on all three sides. A central screened door leads onto the porch from street level, and the entrance door into the main block is a sash door in a plain surround set between 1/1 sash windows. Above the porch a paired window centered in the peak of the gable consists of two 1/1 sash windows in plain surrounds. Similar windows occur in the northeastern elevation, two paired and one single 1/1 sash windows. On the southwestern elevation are three single 1/1 sash windows and a set of louvered windows at the southern end. A brick chimney rises from the northeast slope of the roof near the eastern end.

Charlotte B. McDaniel House and Cottage c. 1920s (later alterations)
113 Atlantic Avenue (tax map #3-34-13.20-74)
Figure 42; Plates 96 and 97
CRS #S-8031

Description: The Charlotte B. McDaniel House is a one story wood framed dwelling composed of a gable roofed ell plan main block with one story shed roofed enclosed porches filling in the ell and extending the southeastern or rear elevation. Composite shingles cover the foundation and exterior walls of the main block and also cover the slopes of the overhanging gable roof



Plate 96. Charlotte B. McDaniel House (3-34-13.20-74), From the West.



Plate 97. Charlotte B. McDaniel Cottage (3-34-13.20-74), From the Northwest.

and shed roofs. Two chimneys are visible: an exterior concrete block chimney centered on the southwestern gable end of the rear section of the ell and an interior concrete block chimney rising from the northeastern end of the southeastern roof slope of the same rear section. The northwestern gable ended elevation of the main block faces Atlantic Avenue and forms a one bay facade. This facade contains a large fixed light, flanked by 1/1 sash windows. The northwestern elevation of the enclosed porch contains a sash entrance door and a 1/1 sash window. On the northwestern elevation of the enclosed porch a sash entrance door is centered between louvered windows. Flanking the chimney on the southwestern gable end of the main block are 1/1 sash windows. The enclosed porch on the rear elevation has window openings swathed in plastic sheeting.

The Charlotte B. McDaniel Cottage is located southeast of the house at the end of a driveway which parallels its southwestern elevation. The exterior walls of the rectangular one story wood framed cottage are clad in metal siding. The roof is covered in composite shingles. The northwest gable ended elevation forms a three bay facade, the sash entrance door set off-center in plain surrounds between a single light casement window and a paired 1/1 sash window. No chimney is visible.

Stephen R. Leaderman House and Cottage c. 1920s
111 Atlantic Street (tax map #3-34-13.20-75)
Figure 42; Plates 98 and 99
CRS #S-8032

Description: The Stephen R. Leaderman House is a rectangular one story dwelling set on a rock faced CMU foundation and covered by a gabled roof with overhanging eaves and exposed rafter ends. Stucco coats the exterior walls, and the roof is covered with composite shingles. Facing Atlantic Street, the northwestern elevation presents a three bay facade, with an axial sash entrance door set between paired 6/1 sash windows. In front of the entrance door is a one bay porch sheltered by a gabled roof with exposed rafter ends. Wooden posts with molded trim support the porch roof. The window and door openings are set in plain surrounds, a molding atop the lintels forming small hood molds. A shed roofed addition covers the first story of the northeastern elevation and extends beyond the southeastern elevation of the dwelling. A sash entrance door and four narrow single light windows occupy the center of this elevation. A rank of three small four light windows are at the northernmost end of this elevation. Another one story shed roofed addition extends across the southeastern or rear elevation. Two 6/1 sash windows occupy the first story of the southwestern elevation on either side of the axial brick chimney.

The Stephen R. Leaderman Cottage, located northeast of the dwelling, is a one story wood framed rectangular cottage,



Plate 98. Stephen R. Leaderman House (3-34-13.20-75), From the Northwest.



Plate 99. Stephen R. Leaderman Cottage (3-34-13.20-75), From the Northwest.

supported on concrete block piers. Composite shingles cover both the exterior walls and the overhanging gable roof with exposed rafter ends. At the northern end of the northwestern elevation the sash entrance door in plain surrounds is sheltered by a doorhood supported on wooden struts. 6/6 sash windows in plain surrounds occur as a paired window in the northwestern elevation and as a single window centered in the northeastern elevation. No chimney is visible.

Judith E. McMillan House c. 1920s
109 Atlantic Street (tax map 3-34-13.20-76)
Figure 42, Plate 100
CRS #S-8033

Description: The Judith E. McMillan House is a rectangular two story wood framed dwelling with a concrete block foundation, covered on both the exterior walls and the gabled roof with composite shingles. The northwestern gable end faces Washington Street and forms a three bay facade. Covering the first story of the facade is a wood framed screened porch, its flat roof forming a walled deck entered from a second story door in the gable end. The entrance door is centered on the facade, reached by a screen door on the southwest side of the screened porch. On the northeastern and southwestern elevations large shed roofed dormers raise the roof line to enclose two paired second story window openings, each window containing 1/1 sash. Similar paired windows are positioned below the dormer windows on the southwest elevation, while on the northeast elevation single windows appear on the first story. On these side elevations the overhanging roof edges are supported on exposed rafter ends, and the windows are flanked by shutters. A brick exterior chimney stack rises at the center of the northeastern elevation.

Charles D. Joseph House c. 1920s
105 Atlantic Street (tax map #3-34-13.20-78)
Figure 42; Plate 101
CRS #S-8034

Description: The Charles D. Joseph House is a one story wood framed ell-plan house with a rock-faced CMU foundation and an overhanging gable roof with exposed rafter ends. Both the exterior walls and the roof are covered with composite shingles. The northwest gable end of the main block faces Atlantic Street, forming a facade with both an entrance sash door and a 1/1 sash window in plain surrounds, symmetrically placed. Three steps and a handrail give access to the entrance door which is to the north of the window on the facade. Three similar windows are symmetrically arranged on the southwest elevation. On the northeast elevation of the main block are two 1/1 sash windows, and on each of the northeast and northwest elevations of the wing is one 1/1 sash window. A brick exterior chimney stack,



Plate 100. Judith E. McMillan House (3-34-13.20-76), From the Northwest.

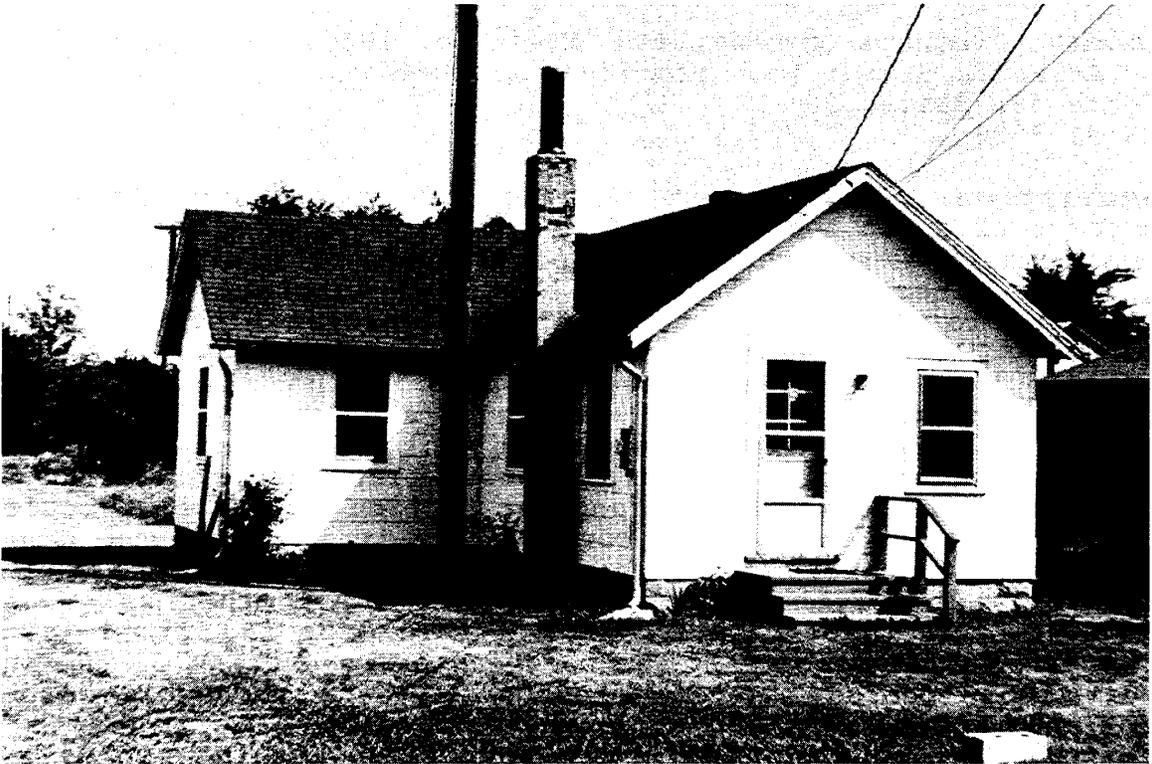


Plate 101. Charles D. Joseph House (3-34-13.20-78), From the North.

now cement covered and topped with a length of pipe, is centered on the northeast wall of the main block between the windows.

J. Theodore Joseph House c. 1930
103 Atlantic Street (tax map #3-34-13.20-79)
Figure 42; Plate 102
CRS #S-8035

Description: The J. Theodore Joseph House is a one and a half story rectangular wood framed dwelling with a concrete block foundation and a gabled roof. Both the exterior walls and the roof are covered with composite shingles. On the facade or northwestern elevation, which is a gable end facing Atlantic Street, four wooden posts support the hipped roof of a one story porch. The three bays of the first story of the facade consist of the central entrance door and flanking 1/1 sash windows in molded trim. Three concrete block steps lead up to the porch, which is supported at the front on concrete blocks. Centered in the gable above the porch roof are paired 1/1 sash windows. The southwestern elevation contains three symmetrically placed 1/1 sash windows, the center window of smaller size and covered with a metal awning. On the northeastern elevation are two 1/1 sash windows and, in the easternmost bay, a three-sided bay window. A brick chimney rises from the ridge of the roof to the northwest of the center point.

Rehoboth Products Company, Inc. House c. 1940s
101 Atlantic Street (tax map #3-34-13.20-80)
Figure 42; Plate 103
CRS #S-8036

Description: The Rehoboth Products Company, Inc. House is composed of a two and a half story wood framed main block, sited toward the rear of the lot. The northwestern gable end faces Atlantic Street. The building has been enlarged with three additions to the northwestern and northeastern elevations. A two story flat roofed rectangular addition covers the facade of the main block and extends beyond it to the northeast, forming an ell plan which has been filled in by a one story flat roofed addition. Extending toward Atlantic Street from the northwestern elevation of the two story flat roofed addition is a one story gable roofed rectangular section with a flat roofed porch filling in the eastern corner where it joins the two story addition. Composite shingles cover the gabled roofs and the exterior walls of the two story addition. All other walls are stuccoed. On the facade a sash entrance door and fixed light window fill the two bays. The northeastern elevation of the one story gable roofed section contains two sets of double leafed sash entrance doors and an exterior brick chimney near the center. The two story flat roofed addition contains paired 1/1 sash windows on the second story and paired louvered windows on the first story on the northeastern elevation. The one story

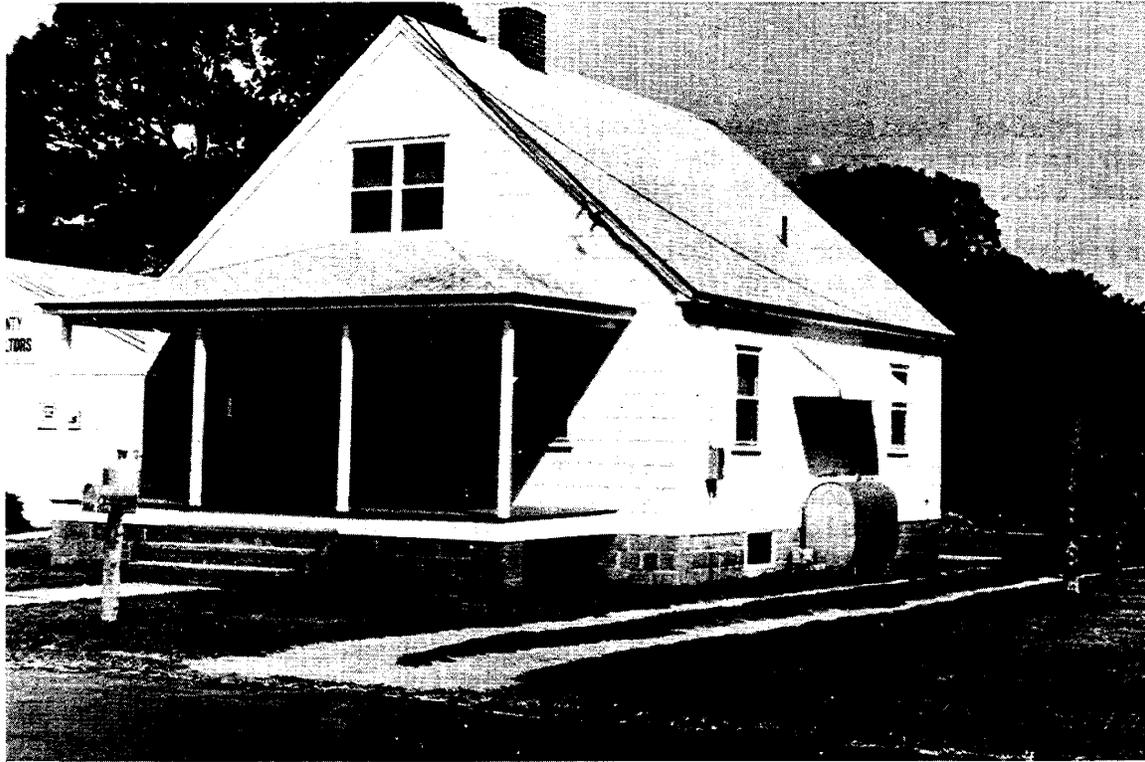


Plate 102. J. Theodore Joseph House (3-34-13.20-79), From the West.



Plate 103. Rehoboth Products Company, Inc. House (3-34-13.20-80), From the Northeast.

flat roofed addition has paired louvered windows and a paneled sash entrance door on the northeastern elevation. The main block second story above shows the paired 1/1 sash windows.

Mary Wardencki House and Cottages 1 - 5 c. 1920s
100 Atlantic Avenue (tax map #3-34-13.20-81)
Figure 42; Plates 104-109
CRS #S-8037

Description: On this property are six buildings, a house and five cottages. The house is sited close to the northeastern end of Atlantic Street, at the eastern corner of the parcel. To the southwest of the house, Cottages 1, 2 and 3 are sited in a row on the northwest side of Atlantic Street. Cottages 4 and 5 are located to the west of the other cottages, set back from Atlantic Street and oriented toward the house.

The house is a one story gable roofed wood framed rectangular block, set on a rockfaced CMU foundation. Wooden clapboards cover the walls, and composite shingles cover the roof. On the northeastern elevation of facade a shed roofed enclosed porch presents a five bay facade, with an axial sash entrance door flanked by two 6/1 sash windows on each side. On the southeastern side elevation two 6/1 sash windows occupy the enclosed porch, two 6/1 sash and one 1/1 sash the main block. The northwestern elevation contains two 6/1 sash windows on the enclosed porch, two single 6/1 sash windows near the rear of the main block, and three 6/1 sash windows on a one story gable roofed addition at the northern half of the main block. A brick chimney rises from the rear slope of the roof, to the northwest of center.

Cottage 1 stands at the northeastern end of the row of three cottages sited with their southeast gable ended elevations close to and facing Atlantic Street. Set on a concrete block foundation, the one story wood framed gable roofed cottage has exterior walls covered with clapboarding. Composite shingles cover the overhanging gable roof on the main block, the hip roof on the enclosed porch projecting from the facade and the hip roof on an addition extending for two bays at the rear. A sash entrance door and a 3/1 sash window occupy the two bay facade of the enclosed porch. One 3/1 sash window is centered on each side elevation of the enclosed porch, and two 3/1 sash windows are placed on each side elevation of the main block. On the rear addition a sash entrance door and a small 3/1 sash window occupy the northeastern elevation, and three 6 light windows are found on the southwestern elevation. The door and window openings are set in plain surrounds with a small molded trim above the lintels. Rafter ends are exposed on both the main block and the hip roofed additions, and a brick chimney rises from the center of the ridge.



Plate 104. Mary Wardencki House (3-34-13.20-81), From the Northeast.



Plate 105. Mary Wardencki Cottage 1 (3-34-13.20-81), From the Southeast.



Plate 106. Mary Wardencki Cottage 2 (3-34-13.20-81), From the Southeast.



Plate 107. Mary Wardencki Cottage 3 (3-34.13.20-81), From the Southeast.



Plate 108. Mary Wardencki Cottage 4 (3-34-13.20-81), From the East.



Plate 109. Mary Wardencki Cottage 5 (3-34-13.20-81), From the East.

Cottage 2 stands between Cottage 1 and Cottage 3. Identical to Cottage 1 in most respects, Cottage 2 differs in the following details: 1) the rear addition has a gabled roof; 2) the walls are covered in brick patterned sheathing paper; 3) the roof lacks the overhang and exposed rafter details; and 4) the facade of the enclosed porch has three bays, a sash entrance door flanked by 3/1 sash windows.

Cottage 3 stands at the southwestern end of the row of three cottages. It is identical to Cottage 1 in most respects, but differs in the following details: 1) the rear addition has a shed roof; 2) the walls are covered with brick patterned sheathing paper; 3) only the enclosed porch roof has the overhang and exposed rafter detail; 4) on the two bay facade of the enclosed porch, the window in the southern bay is a paired 2/2 sash window; 5) the chimney is on the exterior, centered on the southwestern elevation; and 6) the other windows are 2/2 sash.

Cottage 4 stands back from Atlantic Street to the rear of Cottage 3, the northeastern elevation forming the facade. It is identical to Cottage 1 with the following exceptions: 1) the rear addition has a shed roof; 2) the walls are covered with composite siding; 3) the roofs lack the overhang and exposed rafter details; 4) the chimney is coated with asphalt; and 5) the enclosed porch has a three bay facade, a sash entrance door flanked by 6/1 sash windows. The other windows are 6/1 sash as well; and 6) the side entrance is on the southwestern elevation of the rear addition.

Cottage 5 stands parallel to Cottage 4 on the northwest side. It is identical to Cottage 1 with the following exceptions: 1) the enclosed front porch has a corrugated metal covered gable roof continuous with the gable porch of the main block; 2) the foundation consists of concrete block piers; 3) the exterior walls are covered with brick patterned sheathing paper; 4) the entrance door and the 3/1 sash window occupy reversed positions on the two bay facade; 5) fenestration on the side elevations of the main block consists of nine light casement windows; and 6) the chimney is centered on the northwestern slope of the roof.

Albert B. Culver, Jr. House c. 1930
108 Atlantic Street (tax map #3-34-13.20-82)
Figure 42; Plate 110
CRS #S-8038

Description: The Albert B. Culver, Jr., House is a rectangular one story wood framed dwelling on a concrete foundation, covered on the exterior walls with vertical wood siding and on the gable