

CULTURAL RESOURCE SURVEY  
MAIN BUILDING FORM

CRS # K-4622

1. ADDRESS/LOCATION: 2375 Farmington Road

2. FUNCTION(S): historic dwelling current dwelling

3. YEAR BUILT: 1865 CIRCA?:  ARCHITECT/BUILDER: \_\_\_\_\_

4. STYLE OR FLOOR PLAN: I-house; side gable with rear ell

5. INTEGRITY: original site  moved   
if moved, from where other location's CRS # year

list major alterations and additions with years (if known) year  
a. See narrative description.  
b. \_\_\_\_\_

6. CURRENT CONDITION: excellent  good  fair  poor

7. DESCRIPTION: (Describe the resource as completely as possible. Use N/A for not applicable; leave no blanks.)

- a. Overall shape: Rectangular Stories: 2  
Additions:
- b Structural system (if known): Frame
- c. Foundation: materials: Covered; concrete block in other places  
basement: full  partial  not visible  no basement
- d. Exterior walls (original if visible& any subsequent coverings): Now covered with aluminum
- e. Roof: shape: Side gable  
materials: Asbestos shingles  
cornice: Encapsalated in vinyl  
dormers: One, on façade  
chimney: location(s): Gable end, S wall (original); a new one (exterior) concrete block on ell

8. DESCRIPTION OF ELEVATIONS:

- a. Facade: Direction: E
  - 1) Bays 3
  - 2) Windows
    - fenestration Regular
    - type 2/2 and 6/1 sash
    - trim Vinyl
    - shutters Screw-on type (modern)

## Facade (cont'd)

- 3) Door(s)  
     location Center  
     type Single  
     trim Wood
- 4) Porch(es) One small, replaced front porch, gable roof, concrete floors/deck

## b. Side: Direction: N

- 1) Bays 2
- 2) Windows  
     fenestration Regular  
     type 6/1 main block, first floor; 2/2 on second floor (ell has mixture of replaced, 1/1 and 6/1)  
     trim Vinyl  
     shutters Screw-on type (modern)
- 3) Door(s) n/a  
     location n/a  
     type n/a  
     trim n/a
- 4) Porch(es) Enclosed kitchen porch at junction of ell and main block

## c. Side: Direction: S

- 1) Bays Two on main block, 3 on ell
- 2) Windows  
     fenestration Irregular  
     type 6/1 and 1/1  
     trim Wood and/or vinyl  
     shutters Screw-on type (modern)
- 3) Door(s) 4  
     location Two in rear ell, one on enclosed porch; one on garage hyphen  
     type Single  
     trim Wood
- 4) Porch(es) Fully enclosed mud room/porch at east end of this elevation; screened porch on ell


## d. Rear: Direction: W

- 1) Bays 2
- 2) Windows  
     fenestration Irregular  
     type 6/1 sash  
     trim Wood  
     shutters Screw-on type (modern)
- 3) Door(s) One  
     location In rear ell  
     type Single  
     trim Vinyl
- 4) Porch(es) n/a

## 9. INTERIOR:

## 10. LANDSCAPING: n/a

## 11. OTHER COMMENTS: Note that garage is attached by a hyphen.

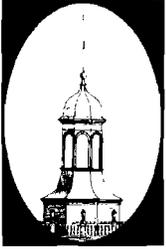

DELAWARE STATE HISTORIC PRESERVATION OFFICE  
15 THE GREEN, DOVER, DE 19901

CULTURAL RESOURCE SURVEY  
SECONDARY BUILDING FORM

CRS # K-4622

1. ADDRESS/LOCATION: 2375 Farmington Road, West Side

2. FUNCTION(S): historic Machine shed #2 current Machine Shed #2

3. YEAR BUILT: 1960 CIRCA?:  ARCHITECT/BUILDER: \_\_\_\_\_

4. STYLE/FLOOR PLAN: Rectangular/vernacular/3-bay open shed

5. INTEGRITY: original site  moved

if moved, from where

original location's CRS # year

list major alterations and additions with years (if known)

year

a.

b.

6. CURRENT CONDITION: excellent  good  fair  poor

7. DESCRIPTION:

a. Structural system Pole

b. Number of stories 1

c. Wall coverings Corrugated metal

d. Foundation n/a

e. Roof

structural system Frame

coverings SS metal

openings n/a

8. DESCRIPTION OF ELEVATIONS:

a. Facade: direction: W

1) bays: 3

2) windows: n/a

3) door(s): n/a

4) other: Three open shed bays/openings

**b. Side: direction: N**

- 1) bays: 1
- 2) windows: n/a
- 3) door(s): n/a
- 4) other: n/a

**c. Side: direction: S**

- 1) bays: 1
- 2) windows: n/a
- 3) door(s): n/a
- 4) other: n/a

**d. Rear: direction: E**

- 1) bays: 1
- 2) windows: n/a
- 3) door(s): n/a
- 4) other: n/a


**9. INTERIOR (if accessible):**

a) Floor plan           Open

b) Partition/walls       None

c) Finishes           n/a

d) Furnishings/machinery   n/a

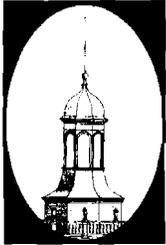

DELAWARE STATE HISTORIC PRESERVATION OFFICE  
15 THE GREEN, DOVER, DE 19901

CULTURAL RESOURCE SURVEY  
SECONDARY BUILDING FORM

CRS # K-4622

1. ADDRESS/LOCATION: 2375 Farmington Road, West Side

2. FUNCTION(S): historic Poultry House #2 current Not used

3. YEAR BUILT: 1970 CIRCA?:  ARCHITECT/BUILDER: \_\_\_\_\_

4. STYLE/FLOOR PLAN: Rectangular/vernacular

5. INTEGRITY: original site  moved   
if moved, from where original location's CRS # year

list major alterations and additions with years (if known) year

a. \_\_\_\_\_

b. \_\_\_\_\_

6. CURRENT CONDITION: excellent  good  fair  poor

7. DESCRIPTION:

a. Structural system Frame

b. Number of stories 1

c. Wall coverings Aluminum

d. Foundation n/a

e. Roof  
structural system Frame; shed  
coverings Corrugated metal  
openings n/a

8. DESCRIPTION OF ELEVATIONS:

a. Facade: direction: W

1) bays: 1

2) windows: n/a

3) door(s): One pedestrian

4) other: n/a

- b. Side: direction: N
  - 1) bays: 1
  - 2) windows: n/a
  - 3) door(s): n/a
  - 4) other: n/a

- c. Side: direction: S
  - 1) bays: 1
  - 2) windows: n/a
  - 3) door(s): n/a
  - 4) other: n/a

- d. Rear: direction: E
  - 1) bays: 1
  - 2) windows: n/a
  - 3) door(s): n/a
  - 4) other: n/a


9. INTERIOR (if accessible):

a) Floor plan            n/a

b) Partition/walls        n/a

c) Finishes            n/a

d) Furnishings/machinery      Has exterior wire pen, attached to south wall.

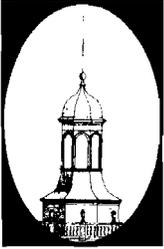

DELAWARE STATE HISTORIC PRESERVATION OFFICE  
15 THE GREEN, DOVER, DE 19901

CULTURAL RESOURCE SURVEY  
SECONDARY BUILDING FORM

CRS # K-4622

1. ADDRESS/LOCATION: 2375 Farmington Road, West Side

2. FUNCTION(S): historic Granary current Storage

3. YEAR BUILT: 1930 CIRCA?:  ARCHITECT/BUILDER: \_\_\_\_\_

4. STYLE/FLOOR PLAN: \_\_\_\_\_

5. INTEGRITY: original site  moved   
if moved, from where original location's CRS # year

list major alterations and additions with years (if known) year  
a. \_\_\_\_\_  
b. \_\_\_\_\_

6. CURRENT CONDITION: excellent  good  fair  poor

7. DESCRIPTION:

- a. Structural system Frame
- b. Number of stories 1
- c. Wall coverings Board and batten, wooden siding
- d. Foundation Rests on concrete blocks
- e. Roof
  - structural system Frame; end gable
  - coverings Wooden shingles
  - openings n/a

8. DESCRIPTION OF ELEVATIONS:

- a. Facade: direction: E
  - 1) bays: 1
  - 2) windows: One in gable end
  - 3) door(s): One, sliding track
  - 4) other: n/a

b. Side: direction: N

- 1) bays: 1
- 2) windows: n/a
- 3) door(s): n/a
- 4) other: n/a

c. Side: direction: S

- 1) bays: 1
- 2) windows: n/a
- 3) door(s): n/a
- 4) other: This wall has an added walk-through that goes to the dairy barn.

d. Rear: direction: W

- 1) bays: 1
- 2) windows: One in gable end
- 3) door(s): n/a
- 4) other: n/a


9. INTERIOR (if accessible):

a) Floor plan           n/a

b) Partition/walls       n/a

c) Finishes           n/a

d) Furnishings/machinery   n/a

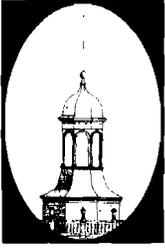

DELAWARE STATE HISTORIC PRESERVATION OFFICE  
15 THE GREEN, DOVER, DE 19901

CULTURAL RESOURCE SURVEY  
SECONDARY BUILDING FORM

CRS # K-4622

1. ADDRESS/LOCATION: 2375 Farmington Road, West Side

2. FUNCTION(S):    historic    Dairy Barn with milk house and calf shed    current    Equipment storage and some animal shelter in main barn

3. YEAR BUILT: 1945    CIRCA?:     ARCHITECT/BUILDER: \_\_\_\_\_

4. STYLE/FLOOR PLAN: Rectangular/vernacular

5. INTEGRITY:    original site     moved   
if moved, from where    original location's CRS #    year

list major alterations and additions with years (if known)    year  
a. See narrative description.  
b.

6. CURRENT CONDITION:    excellent     good     fair     poor

7. DESCRIPTION:

a. Structural system    Masonry (concrete block) with wooden frame super story

b. Number of stories    One plus loft

c. Wall coverings    Wooden siding and concrete block

d. Foundation    Concrete block

e. Roof

structural system    Frame; barn has a round roof; milkhouse has an end-gable roof

coverings    Asphalt shingles

openings    n/a

8. DESCRIPTION OF ELEVATIONS:

a. Facade: direction: W

1) bays: Three on barn and three on milk house

2) windows: Fixed windows, 9-pane on barn

3) door(s): Sliding track doors on barn, pedestrian door on milk house

4) other: n/a

- b. **Side: direction: N**
- 1) **bays:** 1
  - 2) **windows:** Five, fixed pane
  - 3) **door(s):** n/a
  - 4) **other:** This elevation has a small walk-through that was added later to provide access to the granary.

- c. **Side: direction: S**
- 1) **bays:** 7 on barn, 1 on milk house
  - 2) **windows:** Fixed
  - 3) **door(s):** n/a
  - 4) **other:** One garage door (replaced) on milk house

- d. **Rear: direction: E**
- 1) **bays:** 1
  - 2) **windows:** Not visible
  - 3) **door(s):** n/a
  - 4) **other:** Has long rear concrete block and frame addition; 1 story


9. **INTERIOR (if accessible):**

a) **Floor plan**            n/a

b) **Partition/walls**        n/a

c) **Finishes**            n/a

d) **Furnishings/machinery**        **Milk house converted to storage facility and workshop. There is an animal shed attached to the building.**

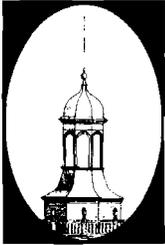

DELAWARE STATE HISTORIC PRESERVATION OFFICE  
15 THE GREEN, DOVER, DE 19901

CULTURAL RESOURCE SURVEY  
SECONDARY BUILDING FORM

CRS # K-4622

1. ADDRESS/LOCATION: 2375 Farmington Road, West Side

2. FUNCTION(S): historic Corncrib current Corncrib

3. YEAR BUILT: 1940 CIRCA?:  ARCHITECT/BUILDER: \_\_\_\_\_

4. STYLE/FLOOR PLAN: Rectangular/vernacular

5. INTEGRITY: original site  moved   
if moved, from where original location's CRS # year

list major alterations and additions with years (if known) year

a. \_\_\_\_\_

b. \_\_\_\_\_

6. CURRENT CONDITION: excellent  good  fair  poor

7. DESCRIPTION:

a. Structural system Frame

b. Number of stories 1

c. Wall coverings Aluminum

d. Foundation On concrete block

e. Roof  
structural system Frame; end gable  
coverings Corrugated metal  
openings 2 on N side; now enclosed (ventilators)

8. DESCRIPTION OF ELEVATIONS:

- a. Facade: direction: E  
1) bays: 3  
2) windows: n/a  
3) door(s): 2 pedestrian  
4) other: n/a

b. Side: direction: N

- 1) bays: 1
- 2) windows: n/a
- 3) door(s): n/a
- 4) other: n/a

c. Side: direction: S

- 1) bays: 1
- 2) windows: n/a
- 3) door(s): n/a
- 4) other: n/a

d. Rear: direction: W

- 1) bays: 1
- 2) windows: n/a
- 3) door(s): n/a
- 4) other: n/a


9. INTERIOR (if accessible):

a) Floor plan            n/a

b) Partition/walls        n/a

c) Finishes            n/a

d) Furnishings/machinery    n/a

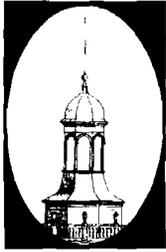

CULTURAL RESOURCE SURVEY  
STRUCTURE (BUILDING-LIKE) FORM

CRS # K-4622

1. ADDRESS/LOCATION: 2375 Farmington Road, West Side

2. FUNCTION: Silo IN USE?

3. YEAR BUILT: 1945 CIRCA?:  ARCHITECT/BUILDER: \_\_\_\_\_

4. STYLE/PLAN: Cylindrical

5. INTEGRITY: original site  moved

if moved, from where original location's CRS # year

list major alterations and additions with dates (if known) year

a.

b.

6. CURRENT CONDITION: excellent  good  fair  poor

7. DESCRIPTION (describe the structure as completely as possible):

a) Overall shape Cylindrical  
height 35 feet  
length N/A  
width 14-foot diameter

b) Structural system: Tile

c) Foundation: Tile

d) Exterior covering: Tile

7. DESCRIPTION (cont'd):

CRS # K-4622

e) Openings Hyphen to dairy barn on southeast side

f) Other features Domed metal roof



DELAWARE STATE HISTORIC PRESERVATION OFFICE  
15 THE GREEN, DOVER, DE 19901

CULTURAL RESOURCE SURVEY  
SECONDARY BUILDING FORM

CRS # K-4622

1. ADDRESS/LOCATION: 2375 Farmington Road, West Side

2. FUNCTION(S): historic Wagon Shed/Poultry House current Wagon Shed/Poultry House

3. YEAR BUILT: 1960 CIRCA?:  ARCHITECT/BUILDER: \_\_\_\_\_

4. STYLE/FLOOR PLAN: Vernacular/rectangular

5. INTEGRITY: original site  moved   
if moved, from where original location's CRS # year

list major alterations and additions with years (if known) year

a. \_\_\_\_\_  
b. \_\_\_\_\_

6. CURRENT CONDITION: excellent  good  fair  poor

7. DESCRIPTION:

a. Structural system Frame

b. Number of stories 1

c. Wall coverings Tar paper

d. Foundation n/a

e. Roof  
structural system Frame; end gable  
coverings SS metal  
openings n/a

8. DESCRIPTION OF ELEVATIONS:

- a. Facade: direction: S
  - 1) bays: 8
  - 2) windows: Two on poultry house (E end; wood)
  - 3) door(s): Two pedestrian on poultry house
  - 4) other: Four open bays for wagon shed; poultry house is enclosed

b. Side: direction: E

- 1) bays: 1
- 2) windows: n/a
- 3) door(s): n/a

4) other: There is a small, wire chicken pen (exterior) on this elevation

c. Side: direction: W

- 1) bays: 1
- 2) windows: n/a
- 3) door(s): n/a

4) other: n/a

d. Rear: direction: N

- 1) bays: 2
- 2) windows: n/a
- 3) door(s): n/a

4) other: n/a


9. INTERIOR (if accessible):

a) Floor plan            Open shed area for wagon shed; poultry house is enclosed

b) Partition/walls        Three partitions in wagon shed

c) Finishes            n/a

d) Furnishings/machinery    Miscellaneous farm machinery stored here

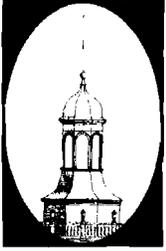

DELAWARE STATE HISTORIC PRESERVATION OFFICE  
15 THE GREEN, DOVER, DE 19901

CULTURAL RESOURCE SURVEY  
STRUCTURE (BUILDING-LIKE) FORM

CRS # K-4622

1. ADDRESS/LOCATION: 2375 Farmington Road, West Side

2. FUNCTION: Pump House IN USE?

3. YEAR BUILT: 1945 CIRCA?:  ARCHITECT/BUILDER: \_\_\_\_\_

4. STYLE/PLAN: Rectangular

5. INTEGRITY: original site  moved

if moved, from where original location's CRS # year

list major alterations and additions with dates (if known) year

a.

b.

6. CURRENT CONDITION: excellent  good  fair  poor

7. DESCRIPTION (describe the structure as completely as possible):

- a) Overall shape rectangular
- height 3 feet
- length 7 feet
- width 3 feet

b) Structural system: Concrete block

c) Foundation: Concrete block


d) Exterior covering: Aluminum cornice; standing seam metal roof

7. DESCRIPTION (cont'd):

CRS # K-4622

e) Openings n/a

f) Other features n/a

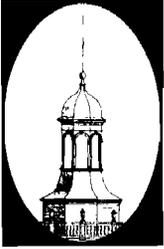

DELAWARE STATE HISTORIC PRESERVATION OFFICE  
15 THE GREEN, DOVER, DE 19901

CULTURAL RESOURCE SURVEY  
SECONDARY BUILDING FORM

CRS # K-4622

1. ADDRESS/LOCATION: 2375 Farmington Road, West Side

2. FUNCTION(S): historic Machine Shed #1 current Machine Shed #1

3. YEAR BUILT: 1970 CIRCA?:  ARCHITECT/BUILDER: \_\_\_\_\_

4. STYLE/FLOOR PLAN: Rectangular/vernacular/3-bay open shed

5. INTEGRITY: original site  moved   
if moved, from where original location's CRS # year

list major alterations and additions with years (if known) year  
a. \_\_\_\_\_  
b. \_\_\_\_\_

6. CURRENT CONDITION: excellent  good  fair  poor

7. DESCRIPTION:

- a. Structural system Pole
- b. Number of stories 1
- c. Wall coverings Plywood and corrugated metal
- d. Foundation n/a
- e. Roof
  - structural system Frame; off-center end gable
  - coverings Standing-seam metal
  - openings n/a

8. DESCRIPTION OF ELEVATIONS:

- a. Facade: direction: E
  - 1) bays: 3
  - 2) windows: n/a
  - 3) door(s): Sliding track bays
  - 4) other: n/a

- b. Side: direction: N
  - 1) bays: 1
  - 2) windows: n/a
  - 3) door(s): n/a
  - 4) other: n/a

- c. Side: direction: S
  - 1) bays: 1
  - 2) windows: n/a
  - 3) door(s): n/a
  - 4) other: n/a

- d. Rear: direction: W
  - 1) bays: 1
  - 2) windows: n/a
  - 3) door(s): n/a
  - 4) other: n/a


9. INTERIOR (if accessible):

a) Floor plan           Open

b) Partition/walls       One interior partition

c) Finishes            n/a

d) Furnishings/machinery   n/a

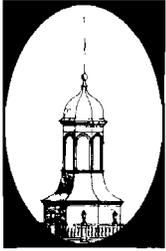

DELAWARE STATE HISTORIC PRESERVATION OFFICE  
15 THE GREEN, DOVER, DE 19901

CULTURAL RESOURCE SURVEY  
SECONDARY BUILDING FORM

CRS # K-4622

1. ADDRESS/LOCATION: 2375 Farmington Road, West Side

2. FUNCTION(S): historic Storage Shed current Firewood Storage

3. YEAR BUILT: 1960 CIRCA?:  ARCHITECT/BUILDER: \_\_\_\_\_

4. STYLE/FLOOR PLAN: Vernacular/rectangular

5. INTEGRITY: original site  moved   
if moved, from where original location's CRS # year

list major alterations and additions with years (if known) year

a. \_\_\_\_\_

b. \_\_\_\_\_

6. CURRENT CONDITION: excellent  good  fair  poor

7. DESCRIPTION:

a. Structural system Concrete block

b. Number of stories 1

c. Wall coverings Concrete block

d. Foundation Concrete block

e. Roof  
structural system Frame; end gable  
coverings SS metal  
openings n/a

8. DESCRIPTION OF ELEVATIONS:

- a. Facade: direction: N
  - 1) bays: 1
  - 2) windows: n/a
  - 3) door(s): 1 vertical, plank Dutch door
  - 4) other: n/a

b. Side: direction: W

- 1) bays: 1
- 2) windows: n/a
- 3) door(s): n/a
- 4) other: n/a

c. Side: direction: E

- 1) bays: 1
- 2) windows: n/a
- 3) door(s): n/a
- 4) other: n/a

d. Rear: direction: S

- 1) bays: 1
- 2) windows: n/a
- 3) door(s): n/a
- 4) other: n/a

9. INTERIOR (if accessible):

a) Floor plan            n/a

b) Partition/walls        n/a

c) Finishes            n/a

d) Furnishings/machinery    n/a



DELAWARE STATE HISTORIC PRESERVATION OFFICE  
15 THE GREEN, DOVER, DE 19901

CULTURAL RESOURCE SURVEY  
SECONDARY BUILDING FORM

CRS # K-4622

1. ADDRESS/LOCATION: 2375 Farmington Road, West Side

2. FUNCTION(S): historic Poultry House #1 current Poultry House

3. YEAR BUILT: 1975 CIRCA?:  ARCHITECT/BUILDER: \_\_\_\_\_

4. STYLE/FLOOR PLAN: Rectangular/vernacular

5. INTEGRITY: original site  moved

if moved, from where

original location's CRS # year

list major alterations and additions with years (if known)

year

a.

b.

6. CURRENT CONDITION: excellent  good  fair  poor

7. DESCRIPTION:

a. Structural system Frame

b. Number of stories 1

c. Wall coverings Aluminum

d. Foundation Concrete block

e. Roof  
structural system Frame; shed  
coverings Corrugated metal  
openings n/a

8. DESCRIPTION OF ELEVATIONS:

- a. Facade: direction: E
  - 1) bays: 4
  - 2) windows: Three; panes missing
  - 3) door(s): One pedestrian
  - 4) other: n/a

b. Side: direction: N

- 1) bays: 1
- 2) windows: n/a
- 3) door(s): n/a
- 4) other: n/a

c. Side: direction: S

- 1) bays: 1
- 2) windows: n/a
- 3) door(s): One pedestrian door with opening near bottom for chickens
- 4) other: n/a

d. Rear: direction: W

- 1) bays: 2
- 2) windows: 2 windows, each side-by-side sliding panes
- 3) door(s): n/a
- 4) other: n/a

9. INTERIOR (if accessible):

a) Floor plan            n/a

b) Partition/walls        n/a

c) Finishes            n/a

d) Furnishings/machinery    n/a



CULTURAL RESOURCE SURVEY  
OBJECT FORM

CRS # K-4622

1. ADDRESS/LOCATION: 2375 Farmington Road, West Side

2. TYPE/FUNCTION/TITLE: Gas Pump

3. YEAR: Construction: 1955 Circa?  Installation: 1955 Circa?   
Previous location(s):

4. DESIGNER/FOUNDER/SCULPTOR: N/A

5. SPONSOR/OWNER: Robert Mason

6. STYLE: Mid-century modern

7. CURRENT CONDITION: excellent  good  fair  poor

8. DESCRIPTION:

a) Object

form Rectangular  
technology and materials Molded metal  
surface finish Plain  
decoration n/a  
dimensions 50" x 21" x 19"  
alterations or changes n/a

b) Base

form n/a  
technology and materials n/a  
surface finish n/a  
decoration n/a  
dimensions n/a  
alterations or changes n/a

8. DESCRIPTION (cont'd):

CRS # K-4622

c) Inscriptions

1) location n/a  
lettering Not legible  
text n/a

2) location n/a  
lettering n/a  
text n/a

3) location n/a  
lettering n/a  
text n/a

d) Other Two nozzles



DELAWARE STATE HISTORIC PRESERVATION OFFICE  
15 THE GREEN, DOVER, DE 19901

CULTURAL RESOURCE SURVEY  
SECONDARY BUILDING FORM

CRS # K-4622

1. ADDRESS/LOCATION: 2375 Farmington Road, West Side

2. FUNCTION(S): historic Combine Shed/Corncrib current Storage

3. YEAR BUILT: 1975 CIRCA?:  ARCHITECT/BUILDER: \_\_\_\_\_

4. STYLE/FLOOR PLAN: Rectangular/vernacular

5. INTEGRITY: original site  moved   
if moved, from where original location's CRS # year

list major alterations and additions with years (if known) year

a.

b.

6. CURRENT CONDITION: excellent  good  fair  poor

7. DESCRIPTION:

a. Structural system Pole

b. Number of stories 1

c. Wall coverings Corrugated metal

d. Foundation n/a

e. Roof  
structural system Frame  
coverings Metal sheets  
openings n/a

8. DESCRIPTION OF ELEVATIONS:

a. Facade: direction: W

1) bays: 2

2) windows: n/a

3) door(s): n/a

4) other: Corn storage area on south side; wagon shed on north


- b. Side: direction: N
  - 1) bays: 1
  - 2) windows: n/a
  - 3) door(s): n/a
  - 4) other: n/a

- c. Side: direction: S
  - 1) bays: 1
  - 2) windows: n/a
  - 3) door(s): n/a
  - 4) other: n/a

- d. Rear: direction: E
  - 1) bays: 2
  - 2) windows: n/a
  - 3) door(s): n/a
  - 4) other: n/a

9. INTERIOR (if accessible):

- a) Floor plan           n/a
  
- b) Partition/walls       n/a
  
- c) Finishes            n/a
  
- d) Furnishings/machinery   n/a

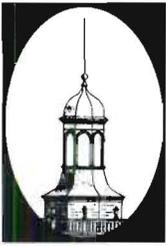

CULTURAL RESOURCE SURVEY  
MAP FORM

CRS # K-4622

1. ADDRESS/LOCATION: 2375 Farmington Road, West Side


2. NOT FOR PUBLICATION  reason: \_\_\_\_\_

3. LOCATION MAP:


Indicate position of resource in relation to geographical landmarks such as streams and crossroads.

(attach section of USGS quad map with location marked or draw location map )

INDICATE NORTH ON SKETCH

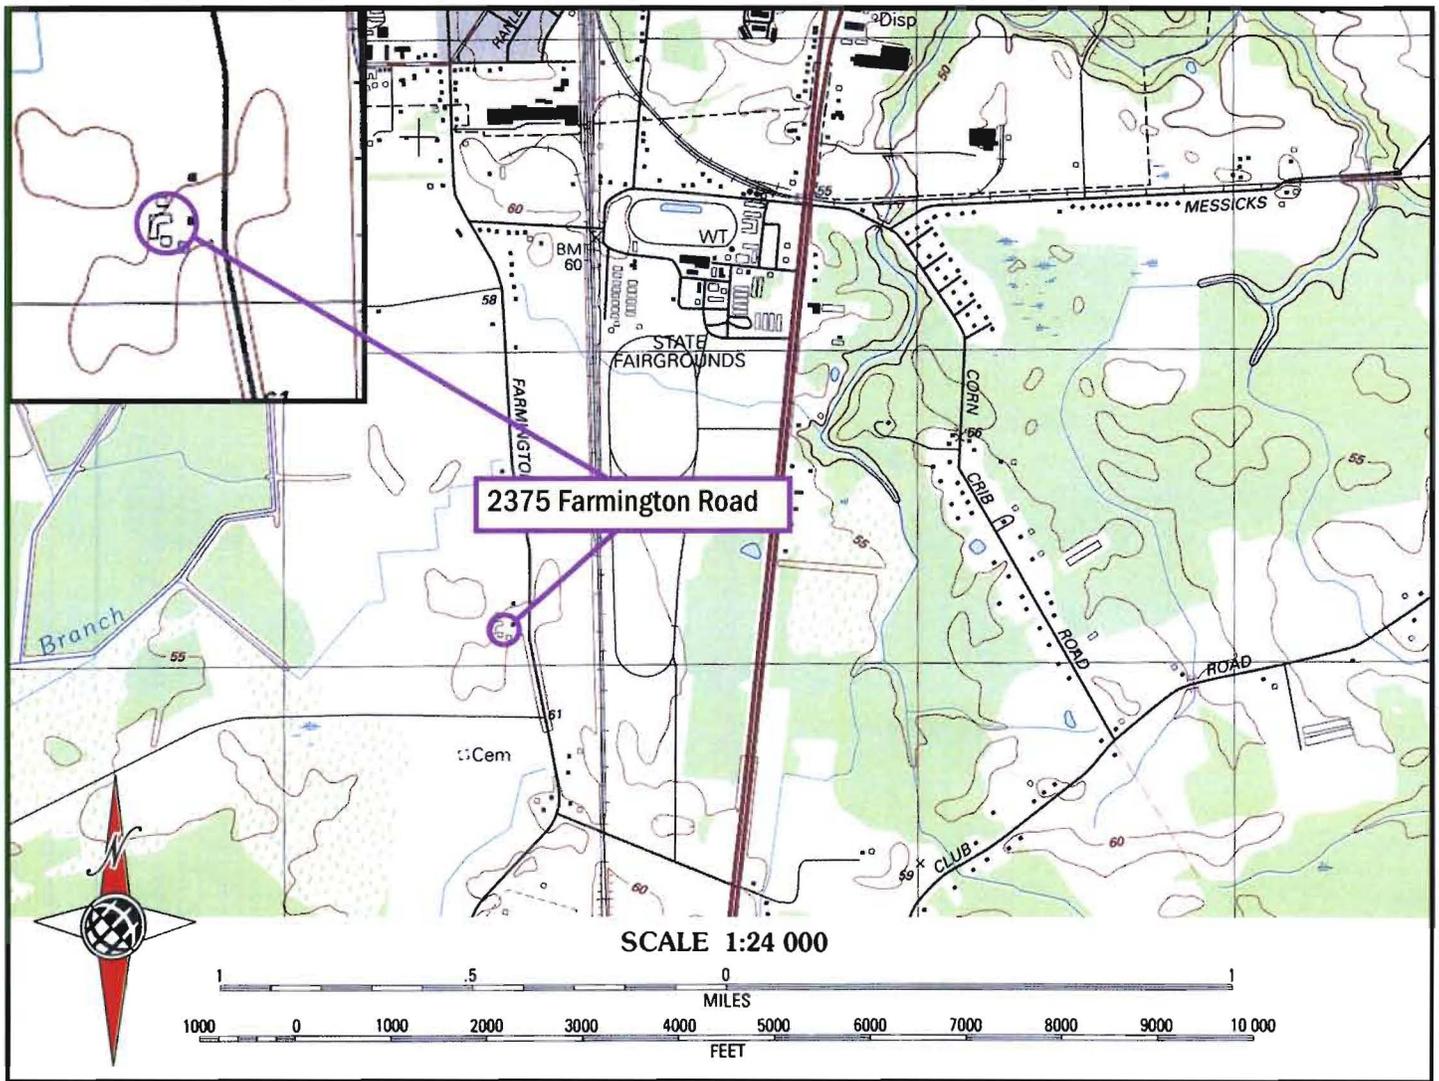



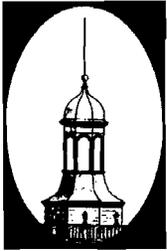

DELAWARE STATE HISTORIC PRESERVATION OFFICE  
15 THE GREEN, DOVER, DE 19901

CULTURAL RESOURCE SURVEY  
SURVEY UPDATE FORM

CRS # K-4622

1. HISTORIC NAME/FUNCTION: Willow Gables Farm/Mrs. C. Jones Property

2. ADDRESS/LOCATION: 2375 Farmington Road, West Side

3. CURRENT CONDITION: excellent  good  fair  poor  demolished

4. INTEGRITY: There have been some alterations and additions to the main house.

5. SETTING INTEGRITY: Property is still farmed.

6. FORMS ADDED (give number of forms completed for each):

#:	Form:	List property types:
1	CRS 2 Main Building Form	Residence
7	CRS 3 Secondary Building Form	Agricultural outbuildings, including dairy barn
0	CRS 4 Archaeological Site Form	
2	CRS 5 Structure (Building-Like) Form	Silo, pump house
0	CRS 6 Structure (Land Feature) Form	
1	CRS 7 Object Form	Gas pump
0	CRS 8 Landscape Elements Form	
	CRS 9 Map Form	N/A
0	CRS 14 Potential District Form	

7. SURVEYOR INFORMATION:

Surveyor name: Lauren Archibald And Christine Tate

Principal Investigator name: Lauren Archibald

Principal Investigator signature: *Lauren Archibald*

Organization: A.D. Marble & Company Date: 7/22/2005

8. OTHER NOTES OR OBSERVATIONS:

CRS# K-4622

9. STATE HISTORIC CONTEXT FRAMEWORK (check all appropriate boxes; refer to state management plan(s)):

a) Time period(s)

- Pre-European Contact
- Paleo-Indian
- Archaic
- Woodland I
- Woodland II

- 1600-1750∇ Contact Period (Native American)
- 1630-1730∇ Exploration and Frontier Settlement
- 1730-1770∇ Intensified and Durable Occupation
- 1770-1830∇ Early Industrialization
- 1830-1880∇ Industrialization and Early Urbanization
- 1880-1940∇ Urbanization and Early Suburbanization
- 1940-1960∇ Suburbanization and Early Ex-urbanization

b) Geographical zone

- Piedmont
- Upper Peninsula
- Lower Peninsula/Cypress Swamp
- Coastal
- Urban (City of Wilmington)

c) Historic period theme(s)

- |   |   |
|---|---|
| <input checked="" type="checkbox"/> Agriculture | <input type="checkbox"/> Transportation and Communication                         |
| <input type="checkbox"/> Forestry               | <input type="checkbox"/> Settlement Patterns and Demographic Changes              |
| <input type="checkbox"/> Trapping/Hunting       | <input checked="" type="checkbox"/> Architecture, Engineering and Decorative Arts |
| <input type="checkbox"/> Mining/Quarrying       | <input type="checkbox"/> Government   |
| <input type="checkbox"/> Fishing/Oystering      | <input type="checkbox"/> Religion   |
| <input type="checkbox"/> Manufacturing          | <input type="checkbox"/> Education  |
| <input type="checkbox"/> Retailing/Wholesaling  | <input type="checkbox"/> Community Organizations                                  |
| <input type="checkbox"/> Finance                | <input type="checkbox"/> Occupational Organizations                               |
| <input type="checkbox"/> Professional Services  | <input type="checkbox"/> Major Families, Individuals and Events                   |

K-4622

NOV 14 1982

CULTURAL RESOURCE SURVEY  
LOCUS IDENTIFICATION FORM

FORM CRS-2

DELAWARE BUREAU OF  
ARCHAEOLOGY AND HISTORIC  
PRESERVATION  
HALL OF RECORDS  
DOVER, DELAWARE 19901  
(302) 678-5314



FOR OFFICE USE ONLY


CRS # K-4622  
Quad MARSHALL  
SPD map # 10-11-15  
Hundred MARSHALL  
DOCUMENT 20-06/78/04/7

1. NAME OF LOCUS: Mr. C. Jones (Beige Area)  
Fence, Dwelling & Farm buildings
2. STREET LOCATION: W 5th Rd. 2nd between Harrington & Rd 215
3. OWNER'S NAME: \_\_\_\_\_ TEL. # \_\_\_\_\_  
ADDRESS: \_\_\_\_\_
4. TYPE OF LOCUS: a) structure  b) district \_\_\_\_\_ c) archaeological site \_\_\_\_\_  
d) other \_\_\_\_\_
5. SURROUNDINGS OF LOCUS: (check more than one if necessary)  
a) fallow field \_\_\_\_\_ b) cultivated field  c) woodland \_\_\_\_\_  
d) scattered buildings  e) densely built up \_\_\_\_\_ f) other \_\_\_\_\_
6. THREATS TO LOCUS: (check more than one if necessary)  
a) none known  b) zoning \_\_\_\_\_ c) roads \_\_\_\_\_ d) developers \_\_\_\_\_  
e) deterioration \_\_\_\_\_ f) other \_\_\_\_\_
7. REPRESENTATION ON OTHER SURVEYS:  
TITLE: \_\_\_\_\_  
TITLE: \_\_\_\_\_  
TITLE: \_\_\_\_\_
8. YOUR NAME: GALE HARRIS TEL. # \_\_\_\_\_  
YOUR ADDRESS: \_\_\_\_\_  
ORGANIZATION (if any) BAHP DATE 7-21-82

USE BLACK INK ONLY

6. SKETCH MAP

Please indicate position of locus in relation to geographical landmarks such as streams and roads.

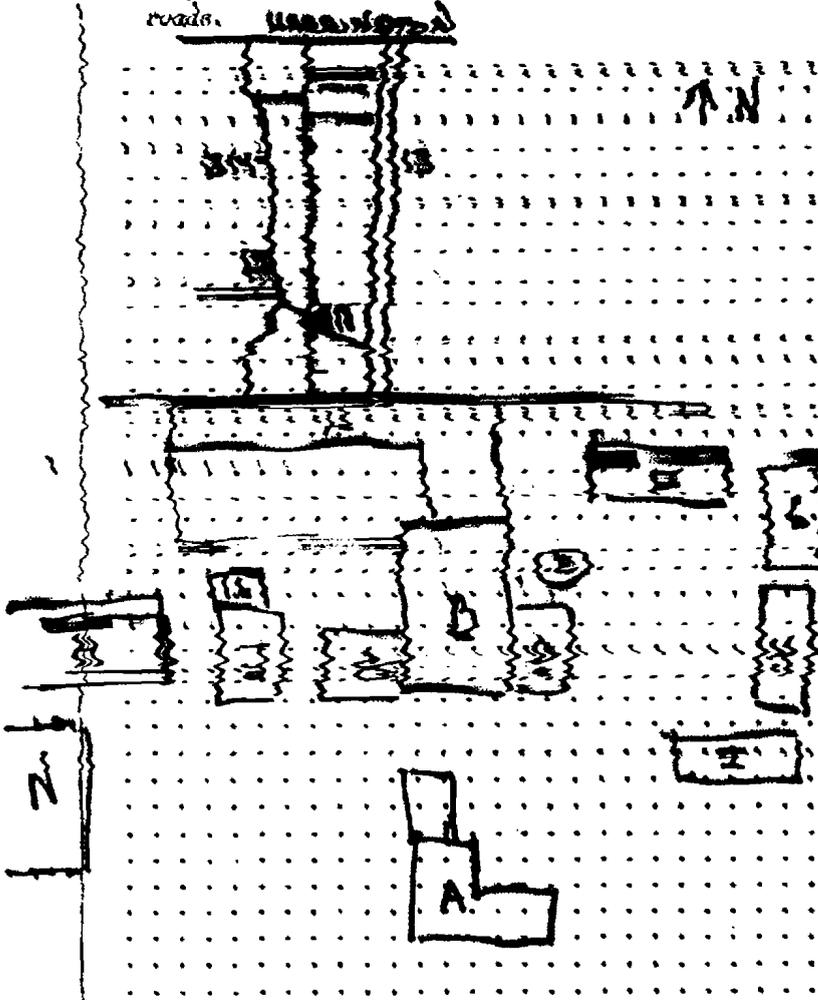

INDICATE NORTH ON SKETCH

USE BLACK INK ONLY

9. COMMENTS:

Consider the following:

- a) relationship to setting
- b) associated traditions or stories
- c) noteworthy features
- d) construction materials used in area

- A FRAME BUILDING W/ STAIRS
- B LARGE 2 STORY AREA
- C MILKHOUSE
- D 1 STORY BARN
- E SHED
- F BARN
- G MILKHOUSE
- H MILKHOUSE
- I " "
- J CORNER
- K SHED
- L WOODSHED / MILKHOUSE
- M MACHINE SHED
- N " " / CORNER

CULTURAL RESOURCES SURVEY  
STRUCTURAL DATA FORM

DELAWARE BUREAU OF  
ARCHAEOLOGY AND HISTORIC  
PRESERVATION  
HALL OF RECORDS  
DOVER, DELAWARE 19901  
(302) 678-5314



FOR A CRS-1  
FOR OFFICE USE ONLY

CRS # M-4422  
Quad AMSTERDAM N  
SPO map # AD-1-78  
Hundred 154-1-1-1  
DOCUMENT 20-06/78/0174


1. ADDRESS OF STRUCTURE : RD. 514, W SIDE, N OF JCT. W/ RD. 515

2. DESCRIBE THE STRUCTURE AS COMPLETELY AS POSSIBLE:

a) Overall shape  
stories 2  
bays 3  
wings 1 1/2 THIN SIDE GABLE WING-

b) Structural system  
FRAME

c) Foundation  
materials NOT VISIBLE, COVERED W/  
basement CONCRETE

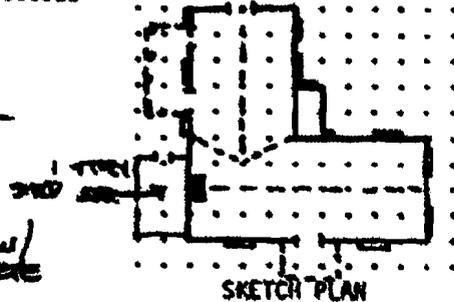

d) Exterior walls  
materials ASBESTOS SHINGLE  
color(s) WHITE

e) Roof  
shape: materials GABLE; ASBESTOS SHINGLE  
cornice PLAIN BR  
dormers FACADE CENTRAL CROSS GABLE  
chimney location(s) LARGE BRICK INTERIOR END W/ CORNICE CA?  
W/ TRIMMED

f) Windows  
spacing SYMMETRICAL  
type 1st FLOOR: 0/1 SASH — 2ND FLOOR: SMALLER 2/2 SASH  
trim PLAIN BOVED SURROUND + TRIPDOWN  
shutters ALUMINIUM LOANDED, DARK GREEN

g) Door  
spacing CENTER FACADE  
type MOLDED 2-PANEL  
trim



[ TWO 4-LIGHT  
WINDOWS IN  
CORNERS OF  
MARI BUCC ]

h) Porches  
location(s) MATERIAL 1 BR, GABLE ENTRANCE PORCH  
materials  
supports  
trim

REAR PORCH: 4 TURNED POSTS  
W/ ZIGZAG BRACKETS

i) Interior details (if accessible)

USE BLACK INK ONLY

3. CONDITION: good  \_\_\_\_\_ deteriorated \_\_\_\_\_

remarks: \_\_\_\_\_

4. INTEGRITY: a) original site ~~intact~~ b) moved \_\_\_\_\_  
c) if moved, when and from where \_\_\_\_\_  
d) list major alterations and dates (if known) \_\_\_\_\_

5. DATE OF INITIAL CONSTRUCTION: MID 19<sup>TH</sup> C.

6. ARCHITECT/BUILDER: \_\_\_\_\_

7. RELATED OUTBUILDINGS:  
a) barn \_\_\_\_\_ b) carriage house \_\_\_\_\_ c) garage \_\_\_\_\_ d) privy \_\_\_\_\_  
e) shed \_\_\_\_\_ f) greenhouse \_\_\_\_\_ g) shop \_\_\_\_\_ h) gardens \_\_\_\_\_  
i) icehouse \_\_\_\_\_ j) springhouse \_\_\_\_\_ k) other \_\_\_\_\_  
describe: SEE LOGS FOR

8. BRIEFLY DISCUSS THE ORIGINAL AND SUBSEQUENT USES OF THE STRUCTURE. NOTE ANY ASSOCIATIONS WITH HISTORIC EVENTS OR PERSONS:

9. Primary References: (include location of reference).

10. Surveyor: V. GENA Date of Form: 7-21-82

USE BLACK INK ONLY

## K-4622

**General Description.** 2375 Farmington Road, known as Willow Gables Farm, in Kent County is located on the west side of the road and is owned by Robert Mason. The 107.7-acre property consists of one dwelling, the original wing of which was constructed ca. 1865, one granary constructed ca. 1930, one dairy barn with a milk house constructed ca. 1945, one corncrib constructed ca. 1945, one silo constructed ca. 1945, one wagon shed with attached poultry house constructed ca. 1960, one pump house constructed ca. 1960, one machine shed (#2) constructed ca. 1960, another machine shed (#1) constructed ca. 1970, one storage shed for firewood constructed ca. 1960, one poultry house (#2) constructed ca. 1970, another poultry (#1) house constructed ca. 1975, a combination combine shed/corncrib constructed ca. 1975, and a garage—originally a smokehouse which was modified, moved to its current site, and attached to the ell of the main house with a hyphen—ca. 1975. A U-shaped gravel lane wends from Farmington Road between the farmhouse and the other farm buildings and back to the road. A small gravel extension on the northern curve leads to west, and a longer gravel extension leads from the southern curve to the southwest. Mature trees shade the south side of the lane and the northeast side of the house. The exterior is in excellent repair. Though Mr. Mason has retired from large-scale farming, he still tills approximately 30.0 acres of this land, he maintains the house and farm structures with care, and he rents out his remaining farmland for agricultural use. The Mason family has occupied this site for over half a century.

**Dwelling.** The L-plan dwelling has undergone several extensive renovations and expansions. The ell of the dwelling is the original house on the site and dates to ca. 1865. The front or main section of the house is a later addition (ca. 1900), as are the single-story shed-roofed enclosed porch attached to the corner where these two blocks meet (at the northwest), the single-story shed-roofed addition to the southeast corner of the front block, the single-story shed-roofed screened porch on the south side of the original structure, and the hyphen which attaches the smokehouse-turned-garage to the western end of the ell. The front block is a three-bay, two-and-one-half story side gable I-house with a half cross gable in the front, regular fenestration, and a centered wooden door sheltered by a small gabled porch with a poured concrete foundation. It has one interior parged brick chimney on the southern end. The ell is a low two-story, three-bay side-gable structure with a door in the east bay on the south side, and a door in the center of the western elevation next to a modern exterior concrete block chimney. The screened porch (on the south side) is enclosed with a wooden frame beneath which early-twentieth-century mill-turned posts and scroll-sawn brackets are visible. The entire house, including the cornice, is clad in aluminum siding, and the roof shingles are asbestos. The foundation is covered in some areas and concrete block in others. The windows are mixed on all elevations. On the eastern elevation (the façade), there are six-over-one light sashes on the first story and two-over-two sashes on the second and attic stories. On the southern elevation, there are six-over-one light sashes on the first story and fixed six-light windows on the second. On the western and northern elevations, the main block has six-over-one light sashes on the first story and two-over-two sashes on the second and attic stories, while the ell has some original six-over-one light sashes and some replacement one-over-one sashes. Many of the windows are framed by fixed, modern (ca. 1975) aluminum shutters and covered with modern aluminum storm windows.

There is now a garage attached to the rear of the house. Originally a smokehouse, this frame structure was moved and modified approximately 30 years ago. It is situated on a concrete pad and clad with asbestos shingles. The roof is covered with asbestos shingles. A single-car rolling replacement garage door takes up the bulk of the gable end façade (the western elevation). A small hyphen on the southern corner of the eastern elevation connects it to the ell of the dwelling.

**Granary.** The gabled, single-story frame granary rests on concrete blocks and is clad in wood board and batten siding. The roof is sheathed with wooden shingles. On the façade (the eastern elevation), there is one small window in the gable end above a sliding door hanging from a single track. The northern elevation is blind, the western elevation has one small window in the gable end, and the southern elevation has an added hyphen to provide a sheltered walk-through to the dairy barn at the western end. The granary is currently used for storage.

**Dairy Barn with Milk House and Cow Shed.** The three-bay by seven-bay, Gothic-arched roof dairy barn is typical of such early-twentieth-century structures on the Eastern Shore. The foundation and first story were constructed of concrete block to discourage fire and promote good hygiene, while the high frame, super-story double loft provided hay storage and ventilation. The roof is sheathed with asphalt shingles, and the gable ends of the barn are clad in sawn clapboards. The façade (the eastern elevation) has centered double wooden plank doors suspended from a single track flanked by fixed nine-light windows. Above the main door are doors at two other levels. On the first is a single wooden plank door suspended from a single track, and above that is a pair of wooden plank casement doors flanked by side-by-side sliding replacement windows. On the northern elevation are five fixed-pane windows and two small added hyphens, one is a walk-through to the granary and the other goes to the silo. The loft of the western elevation is blind; the first story is obscured by an attached L-shaped open calf shed. Part of the southern elevation was obscured; added to the eastern end is single-story, one-bay by three-bay concrete block milk house with two-over-two sash windows on the eastern elevation and a replacement garage door in the gable end on the south side. Some steer are currently housed in the main barn; the rest of the structure is used for storage.

**Corncrib.** The traditional, wooden-frame gabled corncrib is supported by a concrete block foundation. The façade (the eastern elevation), is sheathed in replacement aluminum siding and features a large open wagonway with symmetrical cribs on either side. The cribs are clad in the original vertical slat sawn wood siding and have vertical wood plank pedestrian doors. The roof has two ventilators over each crib. It currently contains feed corn.

**Silo.** The well-preserved, four-story-tall, cylindrical ceramic tile silo has a domed standing seam metal roof. It abuts the western elevation of the granary and the northern elevation of the dairy barn. There is a small hyphen between the barn and the silo.

**Wagon Shed with Attached Poultry House.** This eight-bay by two-bay frame structure has tarpaper walls, a standing seam metal gable roof, and no visible foundation. The western end of the structure is open on the façade (southern elevation) and has three partitions delineating four bays for wagon and farm machine storage. Three-and-one-half bays of the eastern end of the building are enclosed on all four sides to house chickens. The façade of the poultry house has two pedestrian doors and two windows. At its western end (adjoining the easternmost wagon bay) is

a frame and wired poultry pen. The other elevations are blind. Both parts of the building are currently employed for their intended purposes.

**Pump House.** The concrete block pump house is approximately three feet deep by 7.0 feet long by 3.0 feet high. It has an aluminum cornice and a standing seam metal roof.

**Machine Shed #1.** (Constructed ca. 1970) This single-story, one-bay by three-bay frame structure is sheathed in plywood and corrugated metal and has a standing seam metal roof. It has no foundation. The façade (the eastern elevation) has hanging doors suspended from a single track. The other elevations are blind. It has one interior partition and currently houses large farm equipment.

**Machine Shed #2.** (Constructed ca. 1960) This single-story, one-bay by three-bay frame structure is sheathed in corrugated metal and has a standing-seam metal end-gable roof. The façade (the eastern elevation) is open, the other elevations are blind, and there are no interior partitions. It currently houses large farm equipment.

**Firewood Storage Shed.** This single-story, one-bay by one-bay concrete block structure sits on a concrete pad. It has no foundation and an ill-fitting frame gable roof sheathed with standing seam metal. The gable ends are clad in vertical sawn planks, and the façade (the northern elevation) has one vertical plank Dutch door centered under the gable. The other elevations are blind. This building is currently used to store cord wood.

**Poultry House #1.** (Constructed ca. 1975) This converted calf shed now houses chickens. The four-bay by one-bay frame structure sits on a concrete block foundation. It is sheathed in aluminum siding and has a corrugated metal shed roof. The façade (the eastern elevation) has three windows, the northern elevation is blind, the western elevation has two windows at the south end, and the southern elevation has one pedestrian door with an opening near the bottom for chicken ingress and egress.

**Poultry House #2.** (Constructed ca. 1970) The frame one-bay by one-bay poultry house is clad in standing seam metal and has a standing seam metal shed roof. Its façade (the western elevation) is taken up by a vertical plank pedestrian door. There is a wire pen attached to the south wall; the poultry door is obscured by vegetation.

**Combine Shed/Corncrib.** (Constructed ca. 1975) This unusual structure is enclosed on only one side, the northern elevation, which is clad in corrugated and standing seam metal. The log pole frame supports an asymmetrical gable roof. The northern portion of the building is open on both ends (western and eastern) and shelters a combine. The smaller southern section of the building shelters a wire enclosure on a concrete block foundation. It is used to store feed corn. The structure abuts a large rail-fenced paddock to the east.

**Historical Background.** This property could be traced through public records to 1890. In 1890, Franklin J. Smith, as stated in his last will and testament, conveyed the property to Edward A. Smith, Willard E. Smith, Charles W. Smith, and Lillie E. Smith (Kent County Deed Books [KCDB] E2:11). On March 29, 1909, Edward A. Smith sold the property, containing 110.0 acres

along with "...all that farm... and all singular the buildings, improvements, and fixtures," to J. Green and Ella Workman for \$3,200 (KCDB S9:140). On June 22, 1938, J. Green and Ella Workman sold the property, containing 110.0 acres along with "...all that farm...and all singular the buildings, improvements, and fixtures," to Frank and Anne Mozisek for \$2,409 (KCDB K15:27). On May 10, 1943, Frank Mozisek sold the property containing 110.0 acres along with "...all singular the buildings, improvements, and fixtures" to James Edward and Lela P. Taylor for \$4,500 (KCDB 116: 160). On December 28, 1956, James Edward and Lela P. Taylor sold the property, containing 107.7 acres along with "...all that farm," to Robert and Martina Mason for \$22,000 (KCDB K21: 305). On May 20, 1993, Robert and Martina Mason conveyed the 107.7 acre property along with "...all that farm" to themselves (KCDB I53:29).

### **Bibliography**

Kent County Deed Books (KCDB), Kent County Courthouse, Dover, Delaware.